

City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

Taylor Run Condition Assessment

PREPARED FOR: City of Alexandria, CH2M Hill
PREPARED BY: Michael Baker Jr., Inc.
DATE: June 27, 2013 (Revised May 26, 2015)

Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within Taylor Run was completed. In total, 226 storm sewer structures were inspected. This included 112 manholes, 64 inlets, 2 catch basins, 21 I/O structures, 26 culvert points, and one node. In addition, 404 storm sewer pipe segments were inspected. This Technical Memorandum summarizes the results of the field investigations in the Taylor Run watershed.

The inspections were performed by Video Pipe Services (VPS) using the “Lamping” technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined space inspection procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at ground level of a storm structure and screen the structure and its connecting pipes for defects. The lamping technique is a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted. In addition to visually inspecting the stormwater structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in Taylor Run as part of the CASSCA project, but only for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (less than 1%) of the total storm infrastructure length in Taylor Run. The results of the condition assessment of the CMP inspections will be provided in a separate memorandum.

The storm sewer structures and pipes were based on the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established in SCREAM for different conditions of sewer facilities along with corresponding ranges for each defect category. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating.

Table 1 – SCREAM Defect Categories

Defect Category	Score Range	Example
None	0	n/a
Few	1-20	Infiltration weeper
Minimum	21-40	Manhole cracks less than 1/8"
Moderate	41-60	Spalling of chamber wall, large infiltration flow
Major	61-80	Large cracks in cover or frame
Extreme	81-100	Collapsed Pipe

Structure Inspections

As part of this inspection task, 226 storm structures were inspected in the Taylor Run watershed. Figure 1 shows the number of structures identified within each defect category identified in the previous section. Figure 2 is provided to show the geographic location of each structure within the Taylor Run watershed, color coded to its defect category. The average condition score of the storm structures was 35 (Minimum). Twenty-two (22) structures had scores between 61 and 80, placing them in the major category. About 30% of the structures showed few to no defects, while approximately 60% of the structures ranked in the minimum to moderate defect categories. None of the inspected structures had extreme defects.

There were 52 structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field). Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

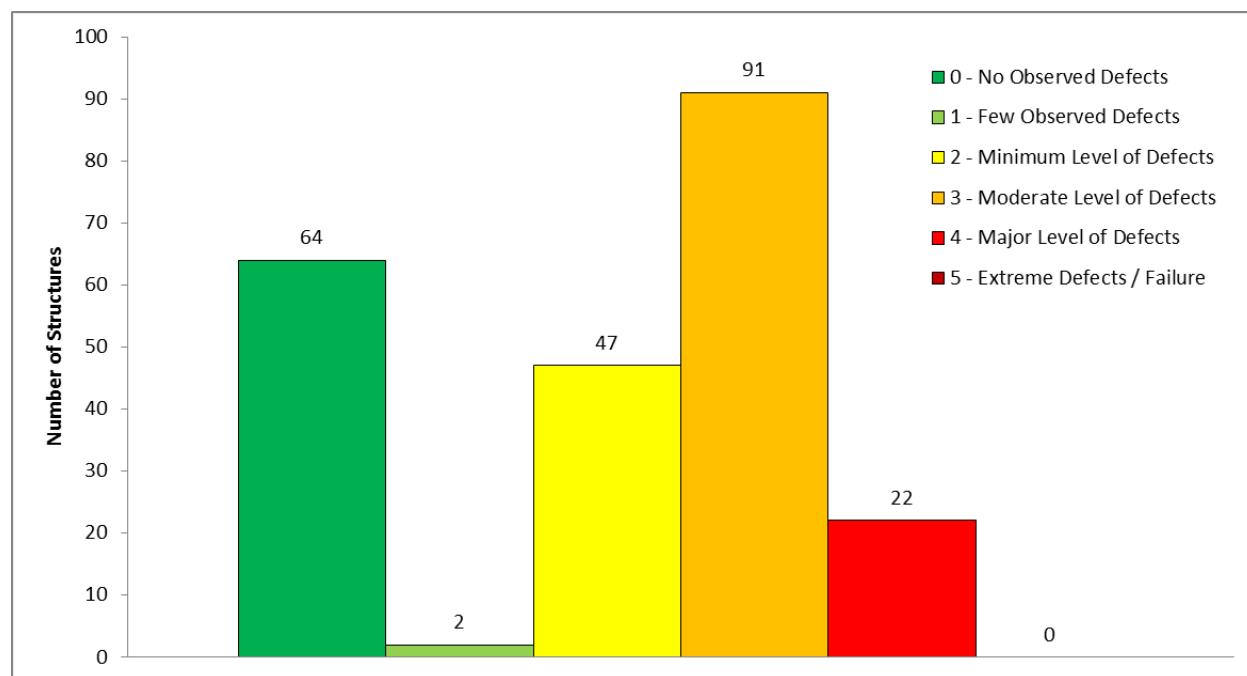


Figure 1. Structure Inspection Summary.

Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).


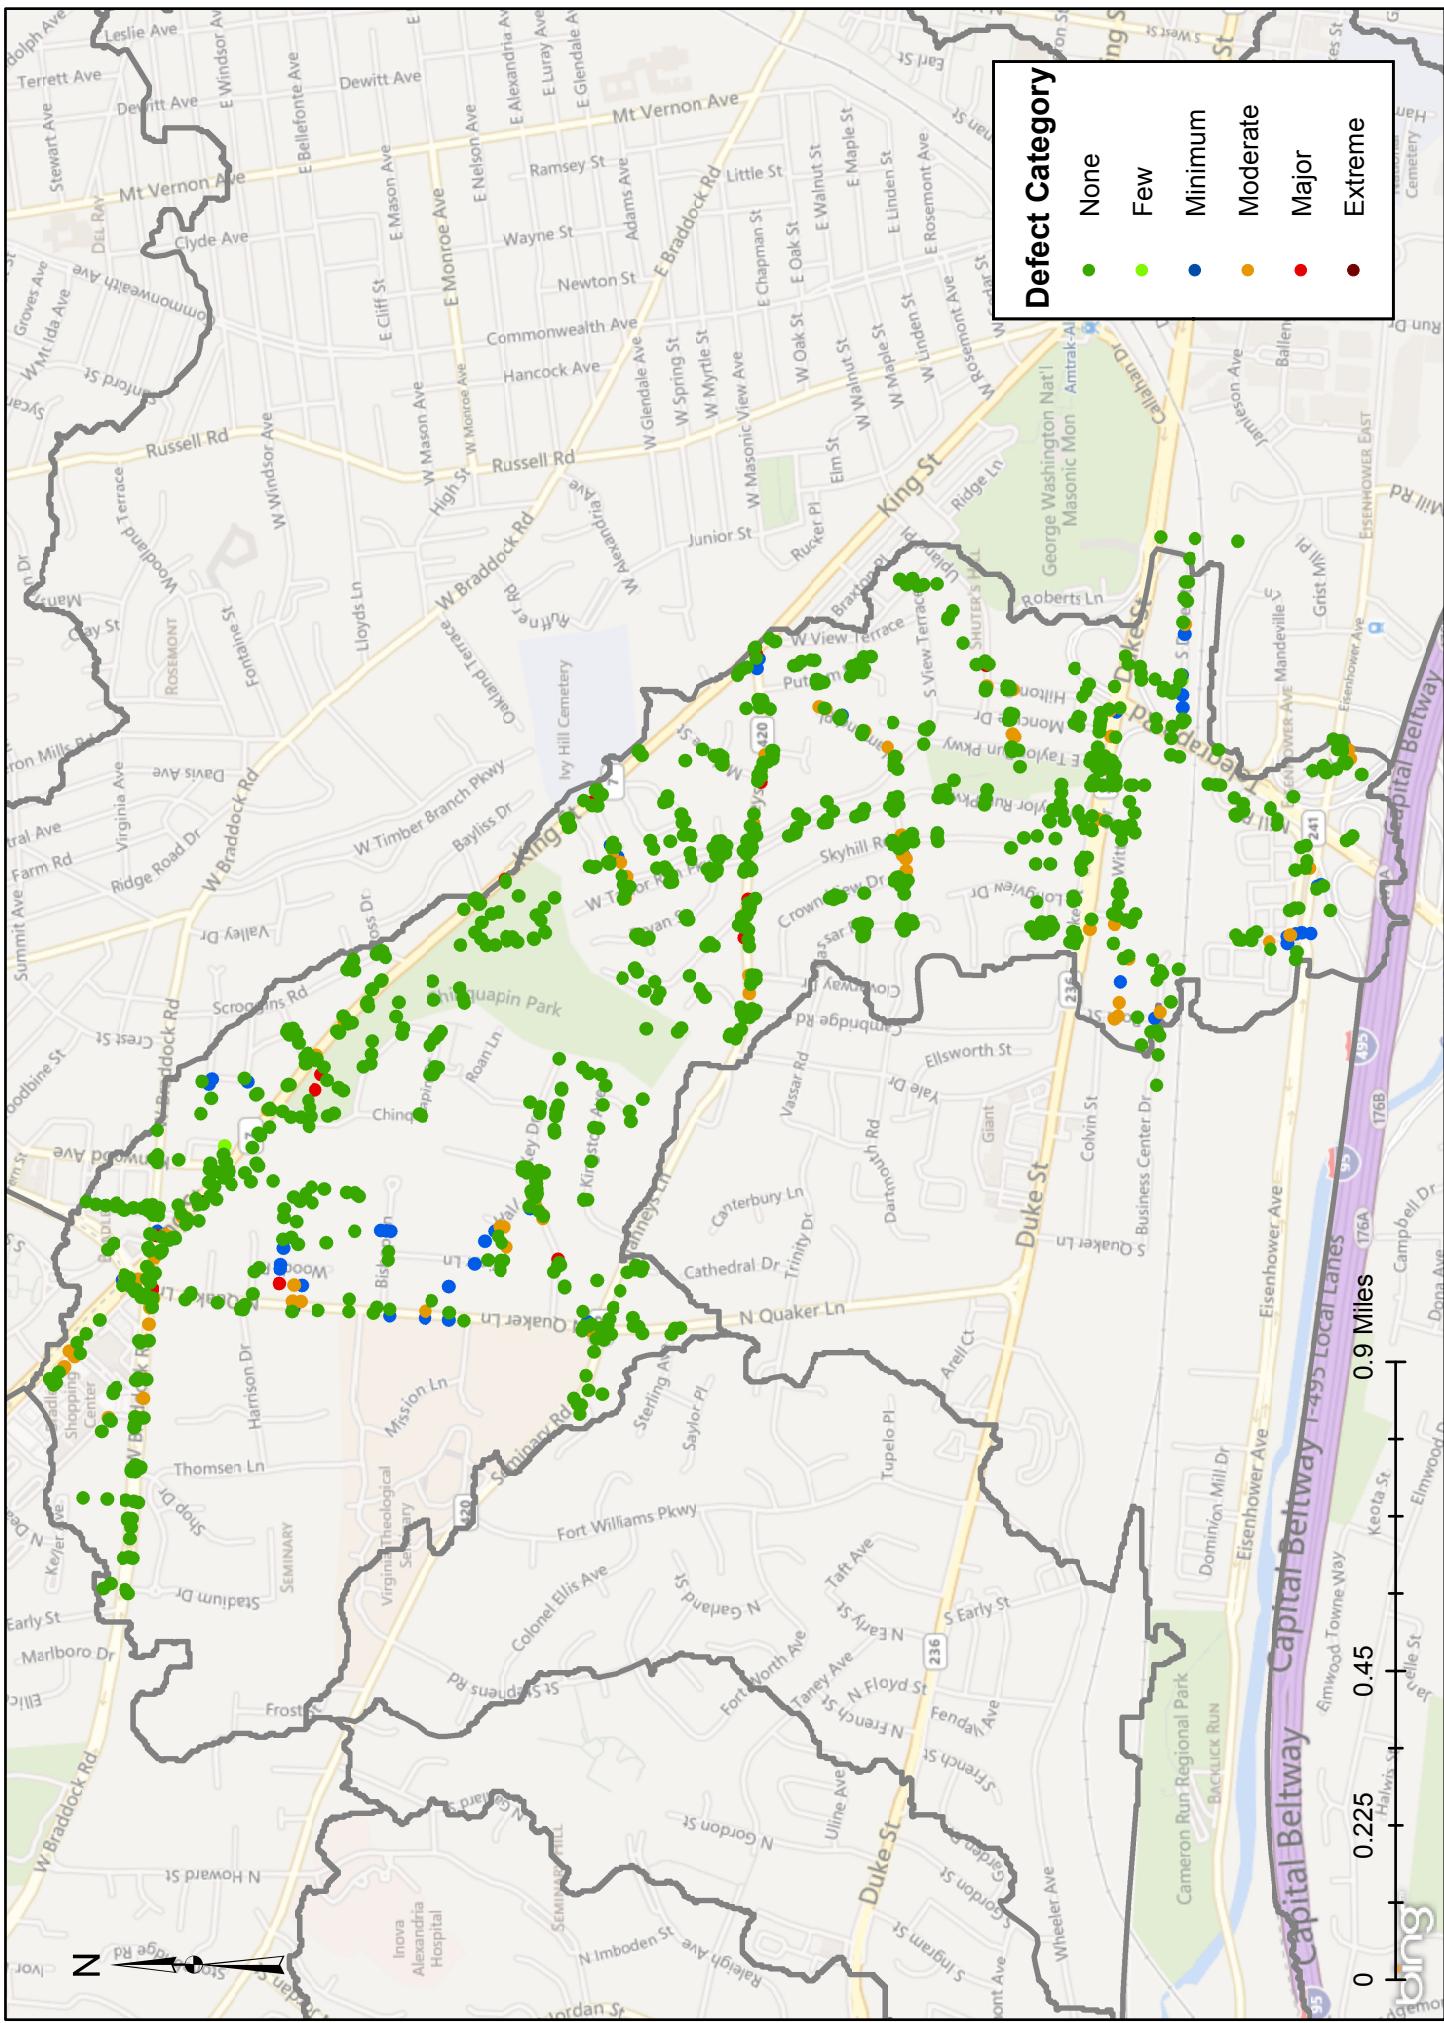


Figure 3 displays the location of the structures classified with major damage only. No extreme defects were observed within Taylor Run watershed. From the figure, the corridors of King Street and Janneys Lane seem to have clusters of structures with high defect scores. The inspection results of the structures were broken down by structure component for further detailed condition assessment. Table 2 lists the number of observed defects by component and severity. Note that the table shows a count of the number of defects found in each component and their respective severity across all structures. Multiple defects may be found in a single component of a structure.

Table 2 - Count of Structure Inspection Observations by MH Component and Severity

Structure Component	Min	Mod	Maj	Extreme
Cover	2	1	0	0
Frame	11	2	0	0
Frame Base Seal	189	22	2	0
Chimney/Shft	240	29	8	0
Chamber	415	36	0	0
Bench	9	3	0	0
Steps	0	0	0	0
Channel	20	7	0	0
Pipe Connection	16	1	2	1

Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).

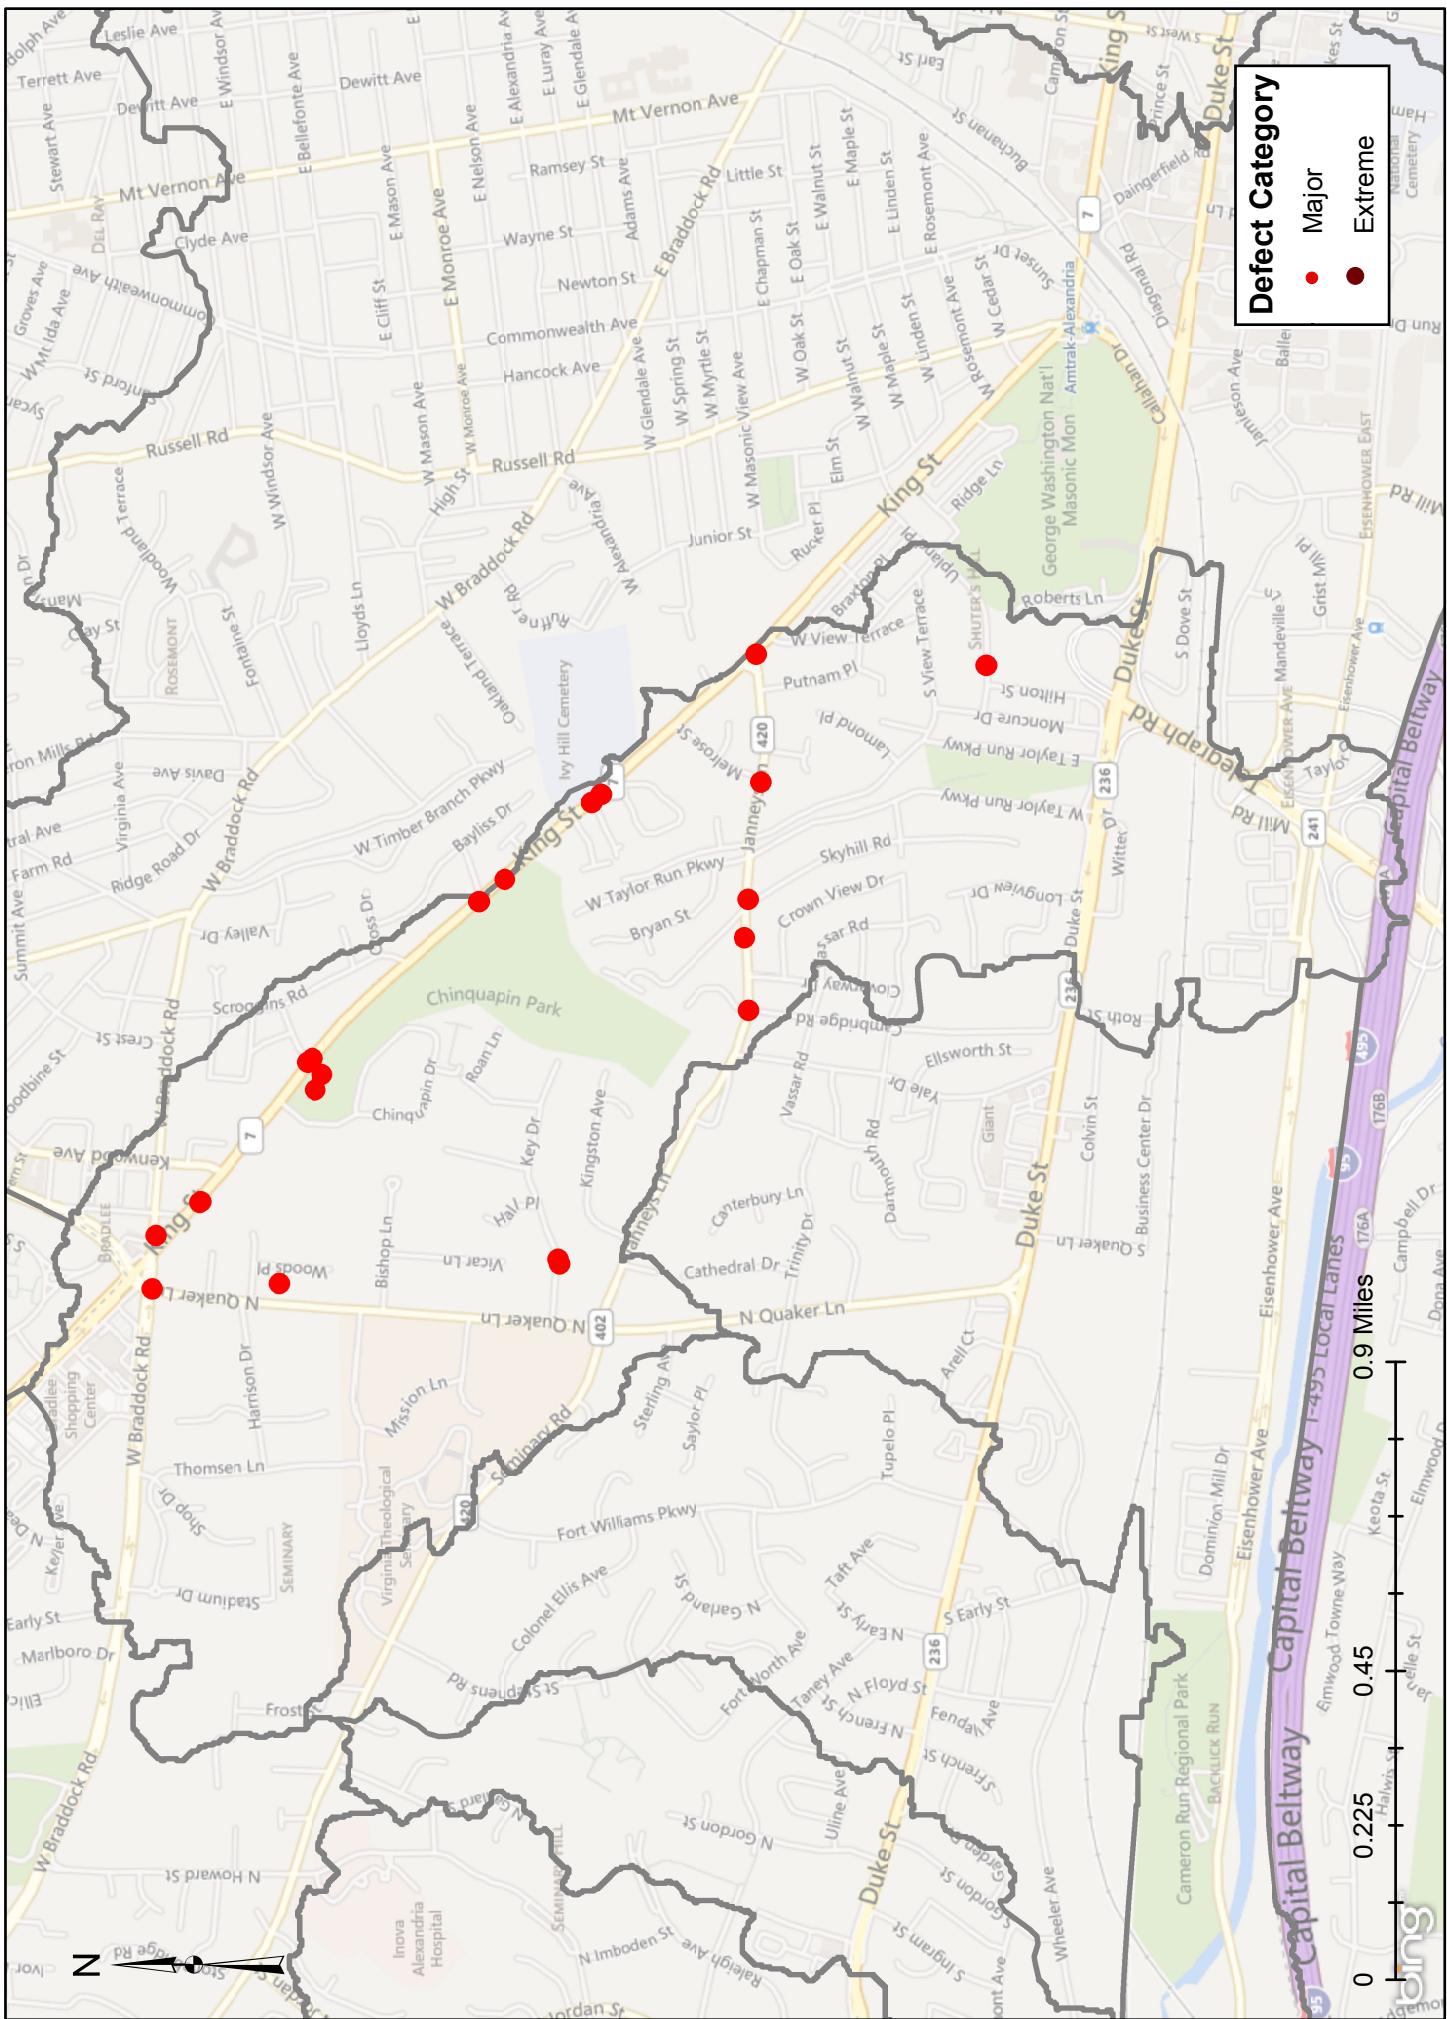

Observed defects of lower severity (Minimum and Moderate defect categories) were frequently associated with the chamber, chimney, and frame base seal components. Twelve (12) examples of major damage were observed in the Taylor Run structures, and one example of extreme damage was recorded¹. Like the lesser severity problems, the major and extreme were still associated with the manhole chimney or frame base seal. Cracks in the chimney between 1/8" to 1/4" in width, for example, are considered major damage. Figures 4 and 5 below illustrate examples of major damage in the chimneys of the manholes.



**Figure 4. Cracked and Corroded Chimney in Structure 000020ND
(Overall SCREAM Score = 72).**



**Figure 5. Cracked Chimney in Structure 000235SMH
(Overall SCREAM Score = 71).**

¹ A structure with an identified “Extreme” defect does not necessarily place the overall structure score in the “Extreme” category. As shown in Figure 1, there were no structures rated in the overall “Extreme” category.

Major damage to the frame base seal is categorized by cracks between 3/8" to 3/4" in width or missing pieces and general deterioration. Figures 6 and 7 below demonstrate major damage to the frame base seal of the structure.



**Figure 6. Frame Base Seal Damage at 002897SMH
(Overall SCREAM Score =70).**



**Figure 7. Frame Base Seal Damage at 000291SMH
(Overall SCREAM Score = 70).**

The structures that ranked among the highest in overall SCREAM score typically did not exhibit major defects but instead exhibited multiple examples of less severe defects to components of the structure. Examples of these structures with overall SCREAM scores ranging from 69 to 80 are shown below in Figures 8-12.



**Figure 8. Cracked and Corroded Chimney at 000015SMH
(Overall SCREAM Score = 80).**



**Figure 9. Damaged Chimney at 002894SMH
(Overall SCREAM Score = 76).**



**Figure 10. Frame Base Seal Damage at 000475SMH
(Overall SCREAM Score = 74).**



**Figure 11. Damaged Chimney and Cracked Bench at 000014SMH
(Overall SCREAM Score = 71).**



**Figure 12. Cracked and Corroded Bench at 000098SMH
(Overall SCREAM Score = 69).**

Appendix A: Structure Inspection Summary provides a summary of the total SCREAM defect score of each storm structure, and Appendix B: Structure Inspection Report provides a detailed report of the defects associated with each inspection.

Pipeline Inspections

In total, 404 storm sewer pipes were inspected in the Taylor Run watershed. Figure 13 shows the number of pipe segments within each defect category. Figure 14 shows a map of the location of each inspected pipeline, color coded by the defect categories identified previously in the memorandum. The average condition score of the 404 storm pipe segments inspected within the Taylor Run watershed was 0.7 (Few to No defects). Inspection results in Taylor Run watershed showed that the pipe segments were observed to be in generally excellent condition, with no defect observed in 95% of the pipes. Sixteen (16) pipe segments were classified as exhibiting few observed defects.


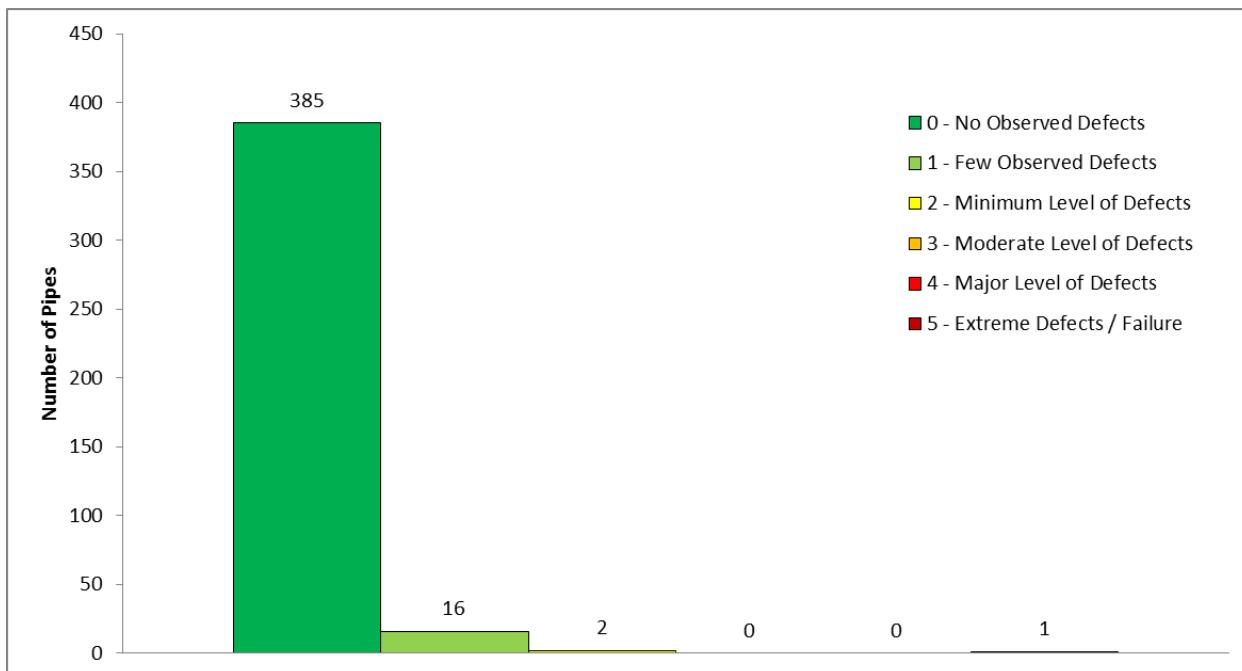


Figure 13. Pipe Lamping Inspection Summary.

Figure 14. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).

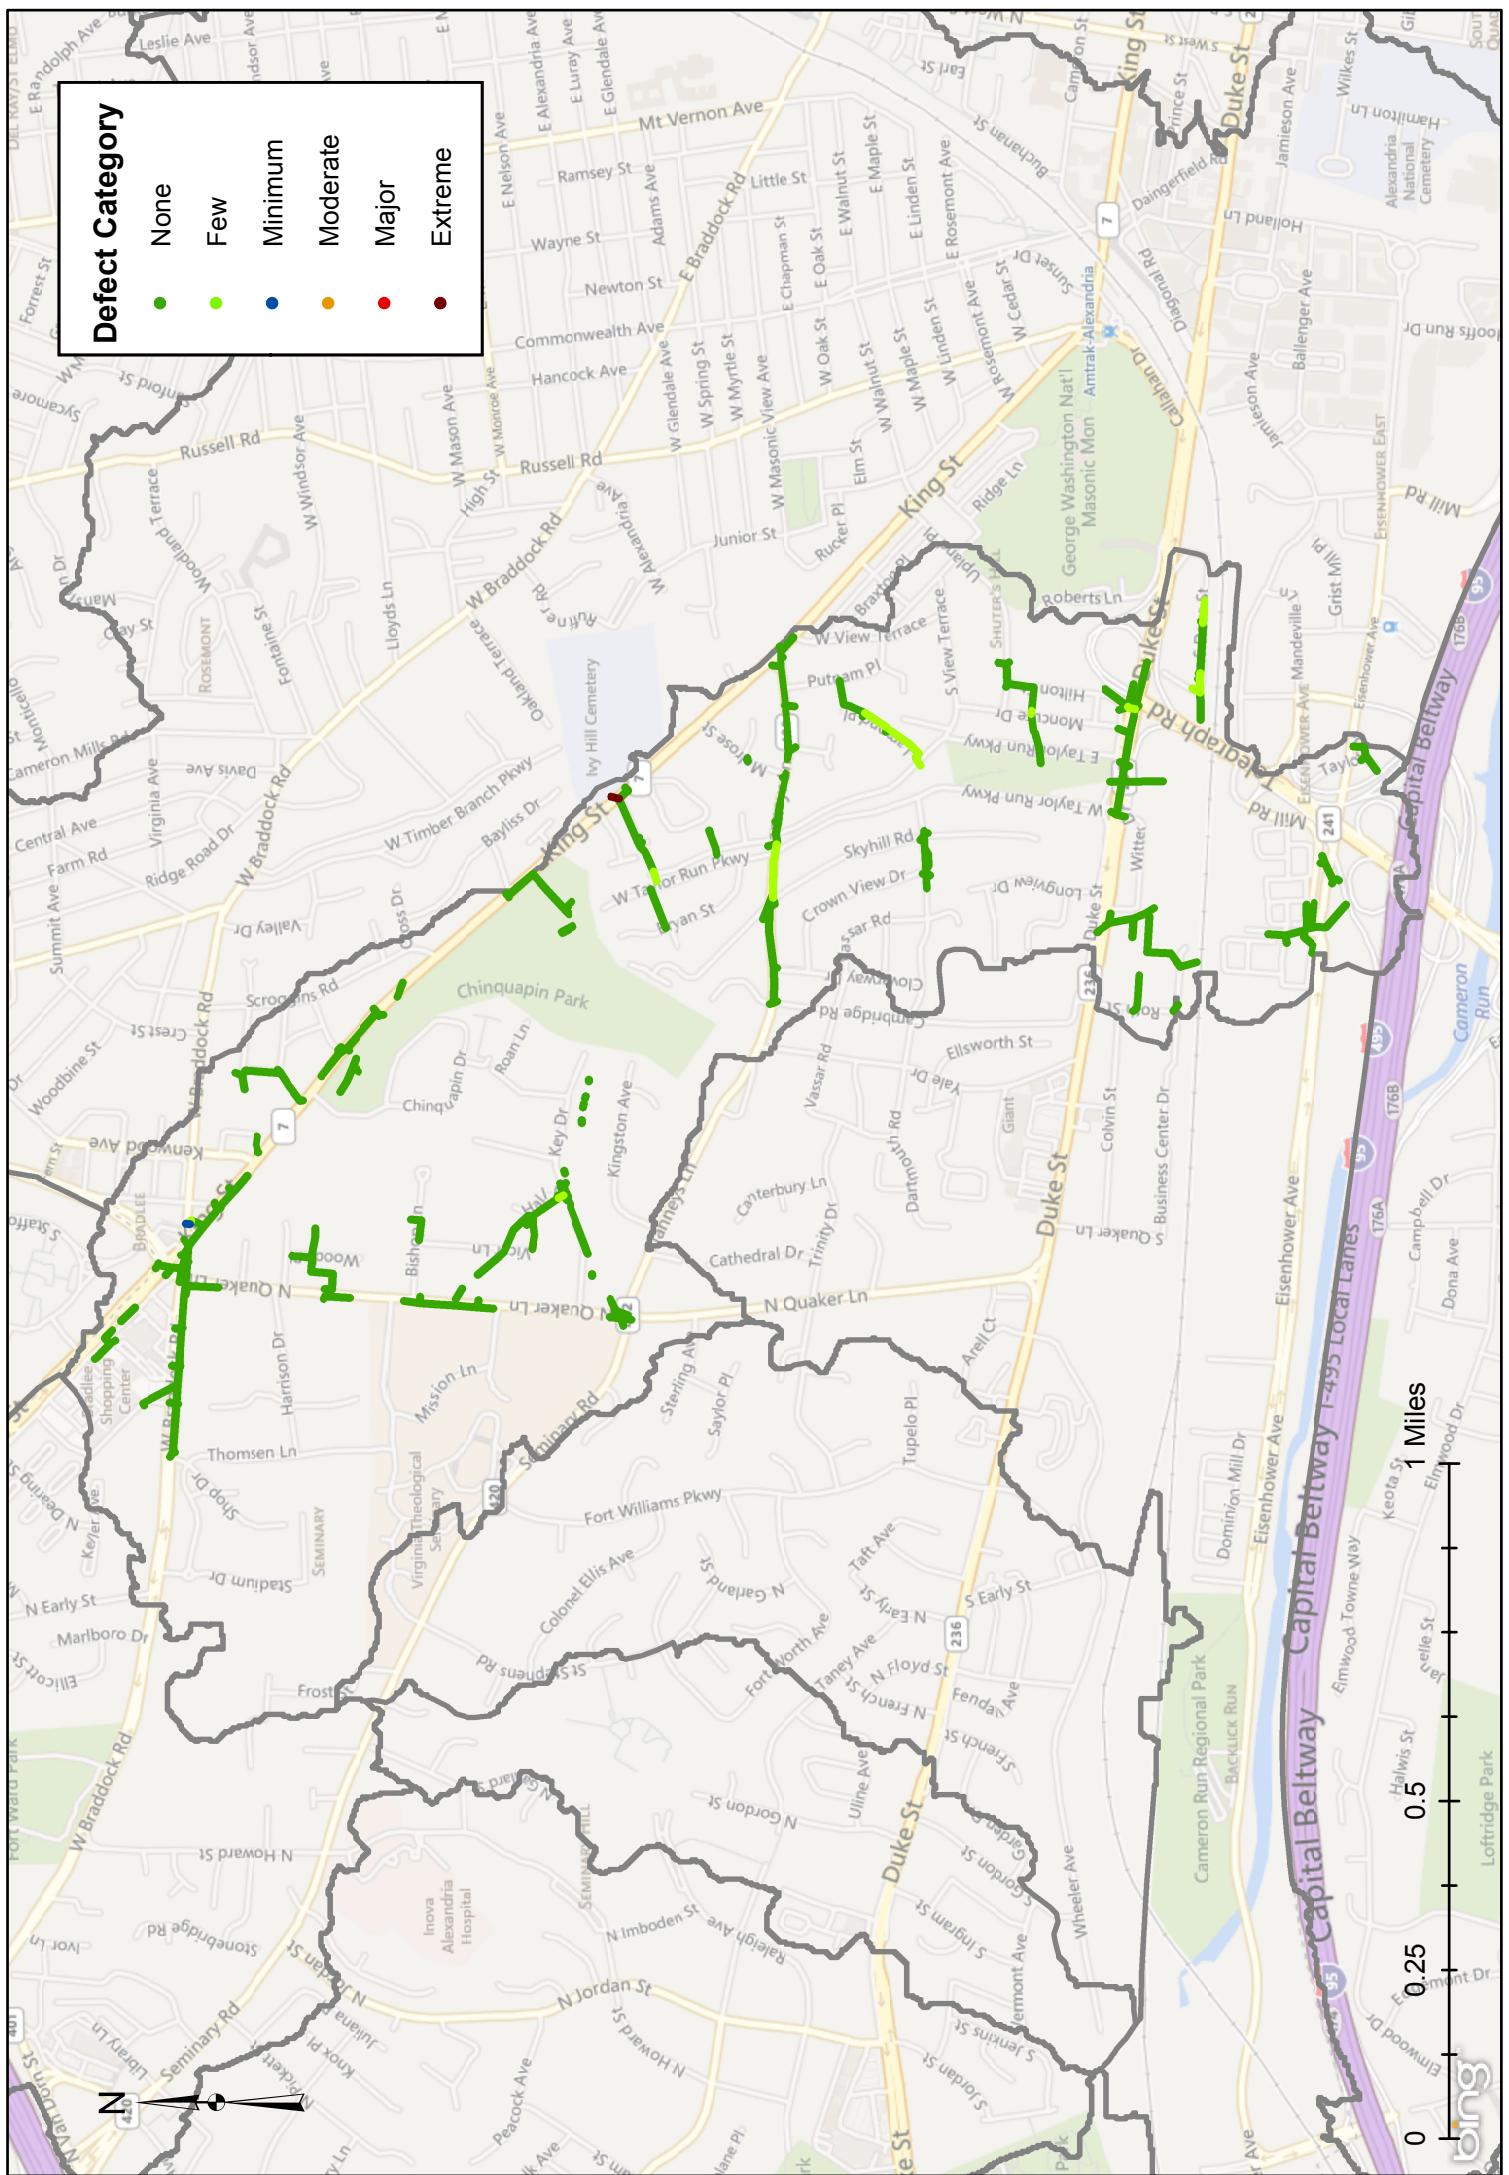

No pipe segments were identified in the major and moderate defect categories (scoring between 41 and 80) and only one pipe in the extreme defect category (scoring 100) as the result of a pipe collapse. The major defects were typically multiple cracks, including cracks in the longitudinal direction, and infiltration into the pipes. Figures 15 through 19 are images taken from the inspections associated with the highest defect pipelines.

Appendix D: Summary of Observed Pipe Defects lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.



**Figure 15. Collapsed Pipe between Structures 000531IO and 002894SMH
(Overall SCREAM Score = 100).**



**Figure 16. Multiple Longitudinal Cracks between Structures 000031SMH and 000032SMH
(Overall SCREAM Score = 34).**



**Figure 17. Cracking between Structures 000032SMH and 000003CB
(Overall SCREAM Score = 9).**



**Figure 18. Cracking between Structures 000265SMH and 000050IO
(Overall SCREAM Score = 9).**



**Figure 19. Infiltration between Structures 000577IN and 000579IN
(Overall SCREAM Score = 8).**

Summary

In total, 226 storm sewer structures and 404 associated pipeline segments were visually inspected for defects and damage using the lamping technique. Overall, the storm sewer infrastructure within the Taylor Run watershed is in good condition. The average condition score for storm structures was 35 (Minimum) and the average condition score for pipe segments was approximately 1 (Few). Less than one percent of the structures and storm pipes inspected had severe observed defects.

Appendix A – Structure Inspection Summary

(Sorted by Defect Score)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Total MH Score

Alexandria - Taylor Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000015SMH	X	3210	KING ST	Yard-Front	09/07/2012	Truck 1	Complete Inspection	80	81	0		3
Taylor Run	002894SMH	X	2836	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	76	76	0		4
Taylor Run	000475SMH	X	904	JANNEYS LA	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	74	76	0		3
Taylor Run	000020ND	X	3300	KING ST	Sidewalk	10/10/2012	Truck 1	Complete Inspection	72	73	0		4
Taylor Run	000014SMH	X	3210	KING ST	Yard-Side	09/07/2012	Truck 1	Complete Inspection	71	72	0		2
Taylor Run	000235SMH	X	723	UPLAND PL	Light Highway Rural Streets	09/14/2012	Truck 1	Complete Inspection	71	72	0		3
Taylor Run	000021SMH	X	1311	QUINCY ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	70	70	0		3
Taylor Run	000291SMH	X	714	JANNEYS LA	Light Highway Rural Streets	09/17/2012	Truck 1	Complete Inspection	70	71	0		3
Taylor Run	002895SMH	X	800	HERMITAGE CT	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	70	71	0		3
Taylor Run	002897SMH	X	2932	KING ST	Pavement Concrete	10/09/2012	Truck 1	Complete Inspection	70	70	0		3
Taylor Run	002905SMH	X	2602	KING ST	Light Highway Rural Streets	09/25/2012	Truck 1	Complete Inspection	70	71	0		3
Taylor Run	000098SMH	X	1408	KEY DR	Driveway	08/23/2012	Truck 1	Complete Inspection	69	71	0		2
Taylor Run	000022SMH	X	3137	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	68	68	5		3
Taylor Run	002893SMH	X	2932	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	68	69	0		3
Taylor Run	000048SMH	X	3410	KING ST	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	67	68	0		2
Taylor Run	000006SMH	X		KING ST	Light Highway Rural Streets	10/10/2012	Truck 1	Complete Inspection	65	66	0		2
Taylor Run	000032SMH	X	3401	KING ST	Light Highway Rural Streets	10/11/2012	Truck 1	Complete Inspection	64	65	0		3
Taylor Run	000294SMH	X	801	JANNEYS LA	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	63	65	0		2
Taylor Run	000036SMH	X	1040	WOODS PL	Yard-Back	09/07/2012	Truck 1	Complete Inspection	62	63	0		2
Taylor Run	000051SMH	X	3300	KING ST	Light Highway Rural Streets	10/10/2012	Truck 1	Complete Inspection	62	63	0		3
Taylor Run	000097SMH	X	1404	KEY DR	Light Highway Rural Streets	08/23/2012	Truck 1	Complete Inspection	62	63	0		3
Taylor Run	000271SMH	X	600	MELROSE ST	Light Highway Rural Streets	09/25/2012	Truck 1	Complete Inspection	61	62	0		3
Taylor Run	000002CB	X	3401	KING ST	Sidewalk	10/11/2012	Truck 1	Complete Inspection	60	61	0		2
Taylor Run	000207SMH	X	2800	DARTMOUTH RD	Light Highway Rural Streets	09/13/2012	Truck 1	Complete Inspection	60	61	0		3
Taylor Run	000265SMH	X	1105	E TAYLOR RUN PY	Yard-Front	09/12/2012	Truck 1	Complete Inspection	60	61	0		2
Taylor Run	000018SMH	X	3210	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	59	60	0		4
Taylor Run	000025SMH	X	3408	KING ST	Light Highway Rural Streets	10/10/2012	Truck 1	Complete Inspection	59	61	0		4
Taylor Run	000202SMH	X	301	CROWN VIEW DR	Light Highway Rural Streets	09/13/2012	Truck 1	Complete Inspection	59	61	0		4
Taylor Run	000231SMH	X	152	HILTON ST	Light Highway Rural Streets	09/14/2012	Truck 1	Complete Inspection	59	61	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000233SMH	X	735	UPLAND PL	Light Highway Rural Streets	09/14/2012	Truck 1	Complete Inspection	59	60	0		3
Taylor Run	000297SMH	X	414	SKYHILL RD	Sidewalk	09/17/2012	Truck 1	Complete Inspection	59	60	0		4
Taylor Run	000687IN	X	103	E TAYLOR RUN PY	Yard-Back	09/14/2012	Truck 1	Complete Inspection	59	60	0		2
Taylor Run	000085SMH	X	1304	KEY DR	Light Highway Rural Streets	08/23/2012	Truck 1	Complete Inspection	58	59	0		3
Taylor Run	000017SMH	X	3137	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	57	58	0		3
Taylor Run	000019SMH	X	3125	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	57	58	0		2
Taylor Run	000035SMH	X	1023	A N QUAKER LA	Sidewalk	09/04/2012	Truck 1	Complete Inspection	57	57	15		2
Taylor Run	000046SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	57	58	0		5
Taylor Run	000084SMH	X	1305	KEY DR	Light Highway Rural Streets	08/23/2012	Truck 1	Complete Inspection	57	58	0		4
Taylor Run	000003SMH	X	3500	KING ST	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000004SMH	X	3526	KING ST	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000005SMH	X	3500	KING ST	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		6
Taylor Run	000007SMH	X	1200	N QUAKER LA	Sidewalk	10/08/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000009SMH	X	3425	KING ST	Light Highway Rural Streets	10/11/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000015IN	X	1028	WOODS PL	Yard-Back	09/07/2012	Truck 1	Complete Inspection	56	57	0		2
Taylor Run	000037SMH	X	3410	KING ST	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000042SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		2
Taylor Run	000043SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000044SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000045SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000050SMH	X	3300	KING ST	Light Highway Rural Streets	10/10/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000073SMH	X	813	VICAR LA	Yard-Side	09/05/2012	Truck 1	Complete Inspection	56	57	0		2
Taylor Run	000074SMH	X	802	HALL PL	Sidewalk	09/05/2012	Truck 1	Complete Inspection	56	57	0		2
Taylor Run	000186SMH	X	3680	KING ST	Parking Lot	09/06/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000208SMH	X	236	W TAYLOR RUN PY	Light Highway Rural Streets	09/13/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000237SMH	X	10	E TAYLOR RUN PY	Easement	10/12/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000251SMH	X	2836	DUKE ST	Parking Lot	09/19/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000252SMH	X		DUKE	Sidewalk	09/19/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000260SMH	X	608	MELROSE ST	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000269SMH	X	509	JANNEYS LA	Light Highway Rural Streets	09/25/2012	Truck 1	Complete Inspection	56	57	0		4
Taylor Run	000270SMH	X	519	JANNEYS LA	Light Highway Rural Streets	09/25/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000283SMH	X	696	JANNEYS LA	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	56	57	0		3
Taylor Run	000292SMH	X	802	JANNEYS LA	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	56	57	0		2
Taylor Run	000474SMH	X	900	JANNEYS LA	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	56	57	0		2
Taylor Run	000817SMH	X	2900	BUSINESS CENTER DR E	Light Highway Rural Streets	09/18/2012	Truck 1	Complete Inspection	56	57	0		4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	002429IN	X	3000	COLVIN ST E	Sidewalk	09/18/2012	Truck 1	Complete Inspection	56	56	0		1
Taylor Run	001563SMH	X	2387	DUKE ST	Driveway	09/24/2012	Truck 1	Complete Inspection	55	56	0		3
Taylor Run	000002SMH	X	3425	KING ST	Light Highway Rural Streets	10/11/2012	Truck 1	Complete Inspection	54	56	0		3
Taylor Run	000038SMH	X	3410	KING ST	Light Highway Rural Streets	10/11/2012	Truck 1	Complete Inspection	54	55	0		3
Taylor Run	000086SMH	X	1401	KEY DR	Light Highway Rural Streets	08/23/2012	Truck 1	Complete Inspection	54	55	0		2
Taylor Run	000209SMH	X	236	W TAYLOR RUN PY	Light Highway Rural Streets	09/13/2012	Truck 1	Complete Inspection	54	55	0		3
Taylor Run	000030SMH	X	3210	KING ST	Sidewalk	10/10/2012	Truck 1	Complete Inspection	53	55	0		3
Taylor Run	000205SMH	X	301	CROWN VIEW DR	Sidewalk	09/13/2012	Truck 1	Complete Inspection	53	54	0		2
Taylor Run	000256SMH	X	109	E TAYLOR RUN PY	Yard-Back	09/14/2012	Truck 1	Complete Inspection	53	54	0		2
Taylor Run	001548SMH	X	233	TELEGRAPH RD	Sidewalk	09/20/2012	Truck 1	Complete Inspection	53	54	0		3
Taylor Run	002902SMH	X	805	HERMITAGE CT	Light Highway Rural Streets	09/12/2012	Truck 1	Complete Inspection	53	54	0		3
Taylor Run	000020SMH	X	3137	KING ST	Light Highway Rural Streets	10/09/2012	Truck 1	Complete Inspection	52	53	0		4
Taylor Run	000008SMH	X	3680	KING ST	Alley	09/06/2012	Truck 1	Complete Inspection	50	51	0		3
Taylor Run	000013IN	X	1023	N QUAKER LA	Sidewalk	09/04/2012	Truck 1	Complete Inspection	50	45	15		3
Taylor Run	000039SMH	X	3410	KING ST	Light Highway Rural Streets	10/11/2012	Truck 1	Complete Inspection	50	51	0		6
Taylor Run	000187SMH	X	3680	KING ST	Sidewalk	09/06/2012	Truck 1	Complete Inspection	50	51	0		3
Taylor Run	000204SMH	X	2800	DARTMOUTH RD	Sidewalk	09/13/2012	Truck 1	Complete Inspection	50	51	0		2
Taylor Run	000206SMH	X	2800	DARTMOUTH RD	Light Highway Rural Streets	09/13/2012	Truck 1	Complete Inspection	50	51	0		3
Taylor Run	000310SMH	X	3737	SEMINARY RD	Light Highway Rural Streets	10/12/2012	Truck 1	Complete Inspection	50	50	0		5
Taylor Run	000467IN	X	3680	KING ST	Sidewalk	09/06/2012	Truck 1	Complete Inspection	50	50	0		5
Taylor Run	000579IN	X	305	E TAYLOR RUN PY	Sidewalk	09/11/2012	Truck 1	Complete Inspection	50	51	0		2
Taylor Run	000701IN	X	1105	E TAYLOR RUN PY	Yard-Back	09/12/2012	Truck 1	Complete Inspection	50	50	0		2
Taylor Run	000764IN	X	1040	W TAYLOR RUN PY	Sidewalk	09/12/2012	Truck 1	Complete Inspection	50	50	0		2
Taylor Run	000767IN	X	319	LAMOND PL	Yard-Side	09/11/2012	Truck 1	Complete Inspection	50	51	0		2
Taylor Run	000858IN	X	802	HALL PL	Sidewalk	09/05/2012	Truck 1	Complete Inspection	50	51	0		3
Taylor Run	001533SMH	X	2460	EISENHOWER AV	Driveway	09/24/2012	Truck 1	Complete Inspection	50	51	0		3
Taylor Run	001546SMH	X	2751	EISENHOWER AV	Light Highway Rural Streets	09/20/2012	Truck 1	Complete Inspection	50	51	0		3
Taylor Run	002430IN	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	Truck 1	Complete Inspection	50	50	0		2
Taylor Run	000253SMH	X	2712	DUKE ST	Light Highway Rural Streets	10/12/2012	Truck 1	Complete Inspection	49	50	0		3
Taylor Run	000859IN	X	1305	KEY DR	Curb/Gutter	08/23/2012	Truck 1	Complete Inspection	49	50	0		3
Taylor Run	000026SMH	X	3301	KING ST	Sidewalk	10/09/2012	Truck 1	Complete Inspection	48	49	0		2
Taylor Run	000041SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	Truck 1	Complete Inspection	48	49	0		2
Taylor Run	000298SMH	X	411	CLOVERWAY	Light Highway Rural Streets	09/26/2012	Truck 1	Complete Inspection	48	49	0		3
Taylor Run	000643IN	X	105	MONCURE DR	Sidewalk	10/12/2012	Truck 1	Complete Inspection	48	49	0		2
Taylor Run	002579SMH	X	1720	W BRADDOCK RD	Light Highway Rural Streets	10/10/2012	Truck 1	Complete Inspection	48	49	0		3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000238SMH	X	2501	DUKE ST	Easement	10/12/2012	Truck 1	Complete Inspection	47	48	0		4
Taylor Run	000469IN	X	3680	KING ST	Easement	09/06/2012	Truck 1	Complete Inspection	46	46	0		2
Taylor Run	000576IN	X	314	MONCURE DR	Sidewalk	09/11/2012	Truck 1	Complete Inspection	46	47	0		4
Taylor Run	000577IN	X	305	E TAYLOR RUN PY	Sidewalk	09/11/2012	Truck 1	Complete Inspection	46	47	0		2
Taylor Run	000815SMH	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	Truck 1	Complete Inspection	45	46	0		2
Taylor Run	000309SMH	X	3737	SEMINARY RD	Sidewalk	09/04/2012	Truck 1	Complete Inspection	44	45	0		4
Taylor Run	000568IN	X	317	LAMOND PL	Sidewalk	09/11/2012	Truck 1	Complete Inspection	44	45	0		3
Taylor Run	000871IN	X	915	N QUAKER LA	Sidewalk	09/04/2012	Truck 1	Complete Inspection	44	45	0		3
Taylor Run	001531SMH	X	2460	EISENHOWER AV	Light Highway Rural Streets	09/24/2012	Truck 1	Complete Inspection	44	44	0		2
Taylor Run	004877IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Complete Inspection	44	45	0		3
Taylor Run	009109IN	X		ROTH	Parking Lot	09/19/2012	Truck 1	Complete Inspection	44	45	0		2
Taylor Run	000606IN	X	302	LAMOND PL	Sidewalk	09/11/2012	Truck 1	Complete Inspection	43	38	15		3
Taylor Run	000591IN	X	301	CROWN VIEW DR	Sidewalk	09/13/2012	Truck 1	Complete Inspection	42	38	5		3
Taylor Run	000879IN	X		Quaker Ln.	Sidewalk	09/04/2012	Truck 1	Complete Inspection	42	42	0		2
Taylor Run	000227SMH	X	151	MONCURE DR	Light Highway Rural Streets	09/14/2012	Truck 1	Complete Inspection	40	40	0		2
Taylor Run	002901SMH	X	805	HERMITAGE CT	Light Highway Rural Streets	09/12/2012	Truck 1	Complete Inspection	40	40	0		4
Taylor Run	000014IN	X	1023	A N QUAKER LA	Yard-Back	10/12/2012	Truck 1	Complete Inspection	38	39	0		3
Taylor Run	000029SMH	X	3300	KING ST	Easement	10/10/2012	Truck 1	Complete Inspection	38	39	0		3
Taylor Run	000005IN	X	3401	KING ST	Sidewalk	10/11/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000012IN	X	1200	N QUAKER LA	Sidewalk	09/04/2012	Truck 1	Complete Inspection	37	38	0		4
Taylor Run	000069IN	X	1040	WOODS PL	Sidewalk	09/07/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	000070IN	X	1039	WOODS PL	Sidewalk	09/07/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000083IN	X	3300	KING ST	Easement	09/07/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	000083SMH	X	817	VICAR LA	Yard-Back	09/05/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	000109IN	X	3125	KING ST	Sidewalk	10/09/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000131IN	X	3500	KING ST	Sidewalk	10/11/2012	Truck 1	Complete Inspection	37	38	0		1
Taylor Run	000313SMH	X	1437	JANNEYS LA	Sidewalk	09/04/2012	Truck 1	Complete Inspection	37	38	0		5
Taylor Run	000572IN	X	315	LAMOND PL	Sidewalk	09/11/2012	Truck 1	Complete Inspection	37	38	0		4
Taylor Run	000594IN	X	2806	DARTMOUTH RD	Sidewalk	09/13/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000595IN	X	2800	DARTMOUTH RD	Sidewalk	09/13/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000815IN	X	1316	BISHOP LA	Yard-Front	09/05/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000816IN	X	1313	BISHOP LA	Yard-Front	09/05/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000817IN	X	1313	BISHOP LA	Yard-Front	09/05/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000818IN	X	904	VICAR LA	Yard-Front	09/05/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000822IN	X	817	VICAR LA	Yard-Side	09/05/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000824IN	X	1401	KEY DR	Sidewalk	08/23/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	000872IN	X	3737	SEMINARY RD	Sidewalk	09/04/2012	Truck 1	Complete Inspection	37	38	0		4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000873IN	X	3737	SEMINARY RD	Sidewalk	09/04/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	000874IN	X	3737	SEMINARY RD	Light Highway Rural Streets	09/04/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	000875IN	X	910	VICAR LA	Yard-Back	09/05/2012	Truck 1	Complete Inspection	37	38	0		1
Taylor Run	001549SMH	X	233	TELEGRAPH RD	Sidewalk	09/20/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	002431IN	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	Truck 1	Complete Inspection	37	38	0		1
Taylor Run	004869IN	X	2751	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	004871IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	004878IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	004879IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	004880IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	004908IN	X	100	TELEGRAPH RD	Parking Lot	09/24/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	004910IN	X	100	DOVE ST	Sidewalk	09/24/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	004911IN	X	2412	DUKE ST	Sidewalk	09/24/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	005532IN	X	1430	W BRADDOCK RD	Parking Lot	09/06/2012	Truck 1	Complete Inspection	37	38	0		3
Taylor Run	005535IN	X	2200	MINOR ST	Sidewalk	09/06/2012	Truck 1	Complete Inspection	37	38	0		4
Taylor Run	005770IN	X	806	HERMITAGE CT	Sidewalk	09/12/2012	Truck 1	Complete Inspection	37	38	0		2
Taylor Run	005778IN	X	2602	KING ST	Sidewalk	09/25/2012	Truck 1	Complete Inspection	37	38	0		1
Taylor Run	000268SMH	X	404	JANNEYS LA	Light Highway Rural Streets	09/25/2012	Truck 1	Complete Inspection	29	29	0		3
Taylor Run	000813SMH	X	2900	BUSINESS CENTER DR E	Light Highway Rural Streets	09/18/2012	Truck 1	Complete Inspection	29	29	0		3
Taylor Run	002550SMH	X	1430	W BRADDOCK RD	Light Highway Rural Streets	09/06/2012	Truck 1	Complete Inspection	29	29	0		2
Taylor Run	000003CB	X	3401	KING ST	Sidewalk	10/11/2012	Truck 1	Complete Inspection	28	29	0		2
Taylor Run	000239SMH	X	105	MONCURE DR	Easement	10/12/2012	Truck 1	Complete Inspection	28	29	0		4
Taylor Run	004868IN	X	233	TELEGRAPH RD	Sidewalk	09/20/2012	Truck 1	Complete Inspection	28	29	0		3
Taylor Run	001562SMH	X	100	TELEGRAPH RD	Driveway	09/24/2012	Truck 1	Complete Inspection	22	22	0		3
Taylor Run	004909IN	X	100	DOVE ST	Sidewalk	09/24/2012	Truck 1	Complete Inspection	10	10	0		4
Taylor Run	000056IN	X	2735	FRANKLIN CT	Sidewalk	10/12/2012	Truck 1	Complete Inspection	5	0	5		1
Taylor Run	000001CP	X	3526	KING ST	Easement	09/06/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000001IN	X	2735	FRANKLIN CT	Yard-Back	10/12/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	000002CP	X	3526	KING ST	Easement	09/06/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000003ND	X	2600	BUSINESS CENTER DR E		09/19/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000004ND	X	2600	BUSINESS CENTER DR E		09/19/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000005ND	X	2644	DUKE ST		09/19/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000006IO	X	3300	KING ST		10/12/2012	Truck 1	Not Inspected - Not found	0	0	0		0
Taylor Run	000006ND	X	2644	DUKE ST		09/19/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000007IO	X	915	N QUAKER LA	Easement	09/04/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000008ND	X		DUKE		10/12/2012	Truck 1	Not Inspected - No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000009ND	X	201	W TAYLOR RUN PY		09/19/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000010IO	X	1437	JANNEYS LA	Yard-Back	08/23/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000010ND	X	2600	BUSINESS CENTER DR E		09/19/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000013IO	X	1200	N QUAKER LA	Easement	09/04/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000013SMH	X	3300	KING ST		10/12/2012	Truck 1	Not Inspected - Not found	0	0	0		0
Taylor Run	000015IO	X	3210	KING ST	Easement	09/07/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000016IO	X	3210	KING ST	Creek Bottom	09/07/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000016ND	X	507	JANNEYS LA		09/25/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000017CP	X	201	W TAYLOR RUN PY	Easement	09/11/2012	Truck 1	Complete Inspection	0	0	0		1
TAYLOR RUN	000017CP-A	X		DUKE	Easement	09/11/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000017IO	X	3210	KING ST	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000018CP	X	2600	BUSINESS CENTER DR E	Easement	10/12/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000018CP-A	X		BUISNESS CENTER DRIVE	Easement	10/12/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000019CP	X	611	JANNEYS LA	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000019ND	X	3410	KING ST		10/11/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	000020CP	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000021CP	X	611	JANNEYS LA	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000022CP	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000022ND	X	3425	KING ST		10/11/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	000023CP	X	1412	KEY DR	Driveway	08/23/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000023ND	X	3425	KING ST		10/11/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	000024CP	X	1412	KEY DR	Driveway	08/23/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000024ND	X	3410	KING ST		10/10/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000025CP	X	1300	KEY DR	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000026CP	X	1300	KEY DR	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000027CP	X	1206	KEY DR	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000027IN	X	1200	N QUAKER LA	Sidewalk	10/08/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000028CP	X	1206	KEY DR	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000029ND	X	3300	KING ST		10/12/2012	Truck 1	Not Inspected - Not	0	0	0		0
Taylor Run	000030ND	X	3129	KING ST		10/09/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	000033CP	X	1200	KEY DR	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000034CP	X	1200	KEY DR	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000034ND	X	3301	KING ST		10/09/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000035CP	X	1124	FRANCIS HAMMOND PY	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000035ND	X	3209	KING ST		10/09/2012	Truck 1	Not Inspected - No	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000036CP	X	1124	FRANCIS HAMMOND PY	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000037CP	X	1120	FRANCIS HAMMOND PY	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000037ND	X	3300	KING ST		10/10/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000038CP	X	1120	FRANCIS HAMMOND PY	Driveway	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000038IO	X	3500	KING ST	Easement	09/06/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000039ND	X	2735	FRANKLIN CT		10/12/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000041IO	X	201	W TAYLOR RUN PY	Easement	09/13/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000044IO	X	201	W TAYLOR RUN PY	Easement	09/11/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000047IO	X	2600	BUSINESS CENTER DR E		10/12/2012	Truck 1	Not Inspected - Not found	0	0	0		0
Taylor Run	000048IO	X	201	W TAYLOR RUN PY	Easement	09/14/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000050IO	X	1105	E TAYLOR RUN PY	Easement	09/11/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000051IO	X	927	E TAYLOR RUN PY	Easement	09/11/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000055IO	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000056IO	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000060ND	X	1404	KEY DR		08/23/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000062IO	X	1040	W TAYLOR RUN PY	Easement	09/12/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000066IO	X	801	JANNEYS LA	Creek Bottom	09/17/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000073IO	X	1408	KEY DR	Yard-Front	08/23/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000074IO	X	1302	KEY DR	Easement	08/22/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000081ND	X	3300	KING ST		10/10/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000082IN	X	3300	KING ST		10/12/2012	Truck 1	Not Inspected - Not found	0	0	0		0
Taylor Run	000084IN	X	3300	KING ST	Sidewalk	09/07/2012	Truck 1	Complete Inspection	0	0	0		2
TAYLOR RUN	000087ND	X		DARTMOUTH		09/13/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000097ND	X	151	MONCURE DR		09/14/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000098ND	X	152	MONCURE DR		09/14/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000101ND	X	152	HILTON ST		09/14/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000104ND	X	600	JANNEYS LA		09/25/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000105ND	X	600	MELROSE ST		09/26/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000108ND	X	521	JANNEYS LA		09/25/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000116ND	X	414	SKYHILL RD		09/17/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000117ND	X	707	JANNEYS LA		09/17/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000121ND	X	1302	KEY DR		08/22/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000126CP	X	2932	KING ST	Easement	09/12/2012	Truck 1	Complete Inspection	0	0	0		1
TAYLOR RUN	000126CP-A	X		KING	Easement	09/12/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000127CP	X	2932	KING ST	Easement	09/12/2012	Truck 1	Complete Inspection	0	0	0		1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
TAYLOR RUN	000127CP-A	X		KING	Easement	09/12/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000172IO	X	2900	BUSINESS CENTER DR E	Easement	09/18/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000257SMH	X	2600	BUSINESS CENTER DR E	Easement	09/19/2012	Truck 1	Complete Inspection	0	0	0		3
Taylor Run	000266SMH	X	927	E TAYLOR RUN PY	Yard-Front	09/11/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	000282SMH	X	607	JANNEYS LA		09/26/2012	Truck 1	Not Inspected - Not	0	0	0		0
Taylor Run	000284SMH	X	611	JANNEYS LA		09/26/2012	Truck 1	Not Inspected - Not Opened	0	0	0		0
Taylor Run	000332IO	X	2460	EISENHOWER AV		09/24/2012	Truck 1	Not Inspected - Not found	0	0	0		0
Taylor Run	000334IO	X		TELEGRAPH		09/20/2012	Truck 1	Not Inspected - Not found	0	0	0		0
Taylor Run	000335IO	X	2700	EISENHOWER AV	Parking Lot	09/20/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000530IO	X	2932	KING ST	Easement	09/12/2012	Truck 1	Complete Inspection	0	0	0		1
Taylor Run	000603ND	X		WILLIAMSBURG		09/20/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000616ND	X		WILLIAMSBURG		09/20/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000618ND	X	2600	BUSINESS CENTER DR E		09/24/2012	Truck 1	Not Inspected - Not	0	0	0		0
Taylor Run	000622ND	X		CABIN CREEK		09/20/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000642IN	X	105	MONCURE DR	Sidewalk	10/12/2012	Truck 1	Complete Inspection	0	0	0		4
Taylor Run	000713IN	X	600	MELROSE ST		09/26/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	000758ND	X	2602	KING ST		09/25/2012	Truck 1	Not Inspected - No Access	0	0	0		0
Taylor Run	000814SMH	X	3000	BUSINESS CENTER DR		09/18/2012	Truck 1	Not Inspected - D.N.E	0	0	0		0
Taylor Run	000816SMH	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	Truck 1	Complete Inspection	0	0	0		3
Taylor Run	000816SMH-A	X		ROTH	Parking Lot	09/18/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	000818SMH	X	3000	BUSINESS CENTER DR		09/18/2012	Truck 1	Not Inspected - D.N.E	0	0	0		0
Taylor Run	000820SMH	X	2600	BUSINESS CENTER DR E	Easement	09/19/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	001532SMH	X	2460	EISENHOWER AV	Easement	09/24/2012	Truck 1	Complete Inspection	0	0	0		3
Taylor Run	001560SMH	X	100	TELEGRAPH RD	Easement	09/24/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	002036ND	X		WITTER		09/19/2012	Truck 1	Not Inspected - Not	0	0	0		0
Taylor Run	002105ND	X		Roth		09/18/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	002890SMH	X	2932	KING ST	Parking Lot	09/12/2012	Truck 1	Complete Inspection	0	0	0		3
Taylor Run	002891SMH	X	2932	KING ST	Parking Lot	09/12/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	004064SMH	X		ROTH	Parking Lot	09/18/2012	Truck 1	Complete Inspection	0	0	0		3
TAYLOR RUN	004065SMH	X		ROTH		09/18/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	004066SMH	X		ROTH	Easement	09/20/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	004067SMH	X		WITTER	Parking Lot	09/19/2012	Truck 1	Complete Inspection	0	0	0		3
Taylor Run	004068SMH	X		QUAKER	Light Highway Rural Streets	10/12/2012	Truck 1	Complete Inspection	0	0	0		2
Taylor Run	004865IN	X	2751	EISENHOWER AV	Sidewalk	09/20/2012	Truck 1	Not Inspected - No	0	0	0		0
Taylor Run	004870IN	X	2751	EISENHOWER AV	Easement	09/20/2012	Truck 1	Complete Inspection	0	0	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	004904IN	X	100	TELEGRAPH RD		09/24/2012	Truck 1	Not Inspected - Not	0	0	0		0

Appendix B – Structure Inspection Report
(Includes Defect Detail)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Facility ID

Alexandria - Taylor Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000001CP	X	3526	KING ST	Easement	09/06/2012	09/06/2012	Truck 1	1		0	0	0		1
Taylor Run	000001IN	X	2735	FRANKLIN CT	Yard-Back	10/12/2012	10/12/2012	Truck 1	1		0	0	0		2
Taylor Run	000002CB	X	3401	KING ST	Sidewalk	10/11/2012	10/11/2012	Truck 1	1		60	61	0		2
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Structural							
Taylor Run	000002CP	X	3526	KING ST	Easement	09/06/2012	09/06/2012	Truck 1	1		0	0	0		1
Taylor Run	000002SMH	X	3425	KING ST	Light Highway Rural Streets	10/11/2012	10/11/2012	Truck 1	1		54	56	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Mortar missing	Min: <10% of area	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000003CB	X	3401	KING ST	Sidewalk	10/11/2012	10/11/2012	Truck 1	1		28	29	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000003ND	X	2600	BUSINESS CENTER DR E		09/19/2012	09/19/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000003SMH	X	3500	KING ST	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000004ND	X	2600	BUSINESS CENTER DR E		09/19/2012	09/19/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000004SMH	X	3526	KING ST	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		4
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000005IN	X	3401	KING ST	Sidewalk	10/11/2012	10/11/2012	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000005ND	X	2644	DUKE ST		09/19/2012	09/19/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000005SMH	X	3500	KING ST	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		6
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000006IO	X	3300	KING ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural	Not found	0	0	0	0	0
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching								
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling								
Taylor Run	000006ND	X	2644	DUKE ST		09/19/2012	09/19/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000006SMH	X		KING ST	Light Highway Rural Streets	10/10/2012	10/10/2012	Truck 1	1		65	66	0		2
Taylor Run	000007IO	X	915	N QUAKER LA	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural	Not found	0	0	0	0	1
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching								
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces								
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching								
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching								
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
Taylor Run	000007IO	X	915	N QUAKER LA	Easement	09/04/2012	09/04/2012	Truck 1	1		0	0	0		1
Taylor Run	000007SMH	X	1200	N QUAKER LA	Sidewalk	10/08/2012	10/08/2012	Truck 1	1		56	57	0		3
Taylor Run	000008ND	X	3680	DUKE	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural	Not found	0	0	0	0	0
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching								
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling								
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching								
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling								
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching								
Taylor Run	000008ND	X		KING ST	Alley	09/06/2012	09/06/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000008SMH	X	3680		Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural	No Access	50	51	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Taylor Run	000009ND	X	201	W TAYLOR RUN PY		09/19/2012	09/19/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000009SMH	X	3425	KING ST	Light Highway Rural Streets	10/11/2012	10/11/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000010IO	X	1437	JANNEYS LA	Yard-Back	08/23/2012	08/23/2012	Truck 1	1		0	0	0		1
Taylor Run	000010ND	X	2600	BUSINESS CENTER DR E		09/19/2012	09/19/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000012IN	X	1200	N QUAKER LA	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		37	38	0		4
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Taylor Run	000013IN	X	1023	N QUAKER LA	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		50	45	15		3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Channel	Debris/deposition	Mod: 1-3gal bucket	Maintenanc							
Taylor Run	000013IO	X	1200	N QUAKER LA	Easement	09/04/2012	09/04/2012	Truck 1	1		0	0	0		1
Taylor Run	000013SMH	X	3300	KING ST		10/12/2012	10/12/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	000014IN	X	1023	A N QUAKER LA	Yard-Back	10/12/2012	10/12/2012	Truck 1	1		38	39	0		3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000014SMH	X	3210	KING ST	Yard-Side	09/07/2012	09/07/2012	Truck 1	1		71	72	0		2
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000015IN	X	1028	WOODS PL	Yard-Back	09/07/2012	09/07/2012	Truck 1	1		56	57	0		2
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000015IO	X	3210	KING ST	Easement	09/07/2012	09/07/2012	Truck 1	1		0	0	0		1
Taylor Run	000015SMH	X	3210	KING ST	Yard-Front	09/07/2012	09/07/2012	Truck 1	1		80	81	0		3
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Frame	Cracked / broken / deteriorated	Min: <1/16" (2mm) width		Structural						
					Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth		Structural						
					Cover	Surface wear	Min: smooth spots, 1/16" to 1/8" (2-3mm) mat'l loss		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Cover	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width		Structural						
					Cover	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) mat'l loss		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000016IO	X	3210	KING ST	Creek Bottom	09/07/2012	09/07/2012	Truck 1	1		0	0	0		1
Taylor Run	000016ND	X	507	JANNEYS LA		09/25/2012	09/25/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000017CP	X	201	W TAYLOR RUN PY	Easement	09/11/2012	09/11/2012	Truck 1	1		0	0	0		1
TAYLOR RUN	000017CP-A	X		DUKE	Easement	09/11/2012	09/11/2012	Truck 1	1		0	0	0		1
Taylor Run	000017IO	X	3210	KING ST	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0	0		1
Taylor Run	000017SMH	X	3137	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		57	58	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Taylor Run	000018CP	X	2600	BUSINESS CENTER DR E	Easement	10/12/2012	10/12/2012	Truck 1	1		0	0	0		1
Taylor Run	000018CP-A	X		BUISNESS CENTER DRIVE	Easement	10/12/2012	10/12/2012	Truck 1	1		0	0	0		1
Taylor Run	000018SMH	X	3210	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		59	60	0		4
				Frame	Offset	Mod: 2" to 3" (5-7.5cm)			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Taylor Run	000019CP	X	611	JANNEYS LA	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0	0		1
Taylor Run	000019ND	X	3410	KING ST		10/11/2012	10/11/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000019SMH	X	3125	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		57	58	0		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Mortar missing	Min: <10% of area			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Taylor Run	000020CP	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0	0		1
Taylor Run	000020ND	X	3300	KING ST	Sidewalk	10/10/2012	10/10/2012	Truck 1	1		72	73	0		4
				Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
Taylor Run	000020SMH	X	3137	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		52	53	0		4
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000021CP	X	611	JANNEYS LA	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0	0		1
Taylor Run	000021SMH	X	1311	QUINCY ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		70	70	0		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Mortar missing	Mod: 10-25% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000022CP	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0	0		1
Taylor Run	000022ND	X	3425	KING ST		10/11/2012	10/11/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000022SMH	X	3137	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		68	68	5		3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chimney/Shft	Mortar missing	Mod: 10-25% of area		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Channel	Debris/deposition	Min: <1gal bucket	Maintenance							
Taylor Run	000023CP	X	1412	KEY DR	Driveway	08/23/2012	08/23/2012	Truck 1	1		0	0	0		1
Taylor Run	000023ND	X	3425	KING ST		10/11/2012	10/11/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000024CP	X	1412	KEY DR	Driveway	08/23/2012	08/23/2012	Truck 1	1		0	0	0		1
Taylor Run	000024ND	X	3410	KING ST		10/10/2012	10/10/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000025CP	X	1300	KEY DR	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000025SMH	X	3408	KING ST	Light Highway Rural Streets	10/10/2012	10/10/2012	Truck 1	1		59	61	0		4
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000026CP	X	1300	KEY DR	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000026SMH	X	3301	KING ST	Sidewalk	10/09/2012	10/09/2012	Truck 1	1		48	49	0		2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Taylor Run	000027CP	X	1206	KEY DR	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000027IN	X	1200	N QUAKER LA	Sidewalk	10/08/2012	10/08/2012	Truck 1	1	No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000028CP	X	1206	KEY DR	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000029ND	X	3300	KING ST		10/12/2012	10/12/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	000029SMH	X	3300	KING ST	Easement	10/10/2012	10/10/2012	Truck 1	1		38	39	0		3
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Taylor Run	000030ND	X	3129	KING ST		10/09/2012	10/09/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000030SMH	X	3210	KING ST	Sidewalk	10/10/2012	10/10/2012	Truck 1	1		53	55	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Mortar missing	Min: <10% of area			Structural					
Taylor Run	000032SMH	X	3401	KING ST	Light Highway Rural Streets	10/11/2012	10/11/2012	Truck 1	1		64	65	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width			Structural					
					Pipe Connection-3	Pipe cracked	Maj: 3/16"-1/4" (5-6mm) width			Structural					
Taylor Run	000033CP	X	1200	KEY DR	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000034CP	X	1200	KEY DR	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000034ND	X	3301	KING ST		10/09/2012	10/09/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000035CP	X	1124	FRANCIS HAMMOND PY	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000035ND	X	3209	KING ST		10/09/2012	10/09/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000035SMH	X	1023	A N QUAKER LA	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		57	57	15		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenanc e						
Taylor Run	000036CP	X	1124	FRANCIS HAMMOND PY	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000036SMH	X	1040	WOODS PL	Yard-Back	09/07/2012	09/07/2012	Truck 1	1		62	63	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Taylor Run	000037CP	X	1120	FRANCIS HAMMOND PY	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000037ND	X	3300	KING ST		10/10/2012	10/10/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000037SMH	X	3410	KING ST	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000038CP	X	1120	FRANCIS HAMMOND PY	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Taylor Run	000038CP	X	1120	FRANCIS HAMMOND PY	Driveway	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000038IO	X	3500	KING ST	Easement	09/06/2012	09/06/2012	Truck 1	1		0	0	0		1
Taylor Run	000038SMH	X	3410	KING ST	Light Highway Rural Streets	10/11/2012	10/11/2012	Truck 1	1		54	55	0		3
Taylor Run	000039ND	X	2735	FRANKLIN CT	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Taylor Run	000039ND	X	2735	FRANKLIN CT		10/12/2012	10/12/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000039SMH	X	3410	KING ST	Light Highway Rural Streets	10/11/2012	10/11/2012	Truck 1	1		50	51	0		6
Taylor Run	000041IO	X	201	W TAYLOR RUN PY	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000041IO	X	201	W TAYLOR RUN PY	Easement	09/13/2012	09/13/2012	Truck 1	1		0	0	0		1
Taylor Run	000041SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		48	49	0		2
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000042SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Taylor Run	000043SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000044IO	X	201	W TAYLOR RUN PY	Easement	09/11/2012	09/11/2012	Truck 1	1		0	0	0		1
Taylor Run	000044SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000045SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		56	57	0		4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000046SMH	X	1200	N QUAKER LA	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		57	58	0		5
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Mortar missing	Min: <10% of area		Structural						
Taylor Run	000047IO	X	2600	BUSINESS CENTER DR E		10/12/2012	10/12/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	000048IO	X	201	W TAYLOR RUN PY	Easement	09/14/2012	09/14/2012	Truck 1	1		0	0	0		1
Taylor Run	000048SMH	X	3410	KING ST	Light Highway Rural Streets	10/08/2012	10/08/2012	Truck 1	1		67	68	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Frame Base Seal Corroded, pitted, spalled I/I evidence Chimney/Shft Cracked Chimney/Shft Chamber I/I evidence Chamber Mortar missing Chamber Corroded, pitted, spalled	Cracked / deteriorated Mod: 1/16"-3/8" (2-10mm) width, small pieces Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	Structural Structural I/I I/I Structural Structural Structural I/I Structural Structural													
Taylor Run	000050IO	X	1105	E TAYLOR RUN PY	Easement	09/11/2012	09/11/2012	Truck 1	1		0	0	0		1
Taylor Run	000050SMH	X	3300	KING ST	Light Highway Rural Streets	10/10/2012	10/10/2012	Truck 1	1		56	57	0		4
Frame Base Seal Corroded, pitted, spalled I/I evidence Chimney/Shft Cracked Chimney/Shft Chamber I/I evidence Chamber Mortar missing Chamber Corroded, pitted, spalled	Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural I/I I/I Structural Structural Structural I/I Structural Structural													
Taylor Run	000051IO	X	927	E TAYLOR RUN PY	Easement	09/11/2012	09/11/2012	Truck 1	1		0	0	0		1
Taylor Run	000051SMH	X	3300	KING ST	Light Highway Rural Streets	10/10/2012	10/10/2012	Truck 1	1		62	63	0		3
Frame Base Seal I/I evidence Cracked / deteriorated Chimney/Shft Cracked Chimney/Shft Chamber	Corroded, pitted, spalled Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16"-3/8" (2-10mm) width, small pieces Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural I/I Structural Structural Structural I/I Structural													

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping								
Taylor Run	000055IO	X	201	W TAYLOR RUN PY	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0	0		1
Taylor Run	000056IN	X	2735	FRANKLIN CT	Sidewalk	10/12/2012	10/12/2012	Truck 1	1		5	0	5		1
					Channel	Debris/deposition	Min: <1gal bucket			Maintenance					
					Creek Bottom	09/17/2012	09/17/2012	Truck 1	1	1					
					KEY DR	08/23/2012	08/23/2012	Truck 1	1	No Access	0	0	0		0
					Easement	09/12/2012	09/12/2012	Truck 1	1		0	0	0		1
					JANNEYS LA	Creek Bottom	09/17/2012	09/17/2012	Truck 1	1		0	0		1
Taylor Run	000069IN	X	1040	WOODS PL	Sidewalk	09/07/2012	09/07/2012	Truck 1	1		37	38	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Taylor Run	000070IN	X	1039	WOODS PL	Sidewalk	09/07/2012	09/07/2012	Truck 1	1		37	38	0		2
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I										
					Corroded, pitted, spalled						Min: <10% mat'l loss, etching			Structural	
					Cracked						Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural	
					I/I evidence						Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I	
Taylor Run	000073IO	X	1408	KEY DR	Yard-Front	08/23/2012	08/23/2012	Truck 1	1		0	0	0		1
Taylor Run	000073SMH	X	813	VICAR LA	Yard-Side	09/05/2012	09/05/2012	Truck 1	1		56	57	0		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Taylor Run	000074IO	X	1302	KEY DR	Easement	08/22/2012	08/22/2012	Truck 1	1		0	0	0		1
Taylor Run	000074SMH	X	802	HALL PL	Sidewalk	09/05/2012	09/05/2012	Truck 1	1		56	57	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000081ND	X	3300	KING ST		10/10/2012	10/10/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000082IN	X	3300	KING ST		10/12/2012	10/12/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	000083IN	X	3300	KING ST	Easement	09/07/2012	09/07/2012	Truck 1	1		37	38	0		3
Taylor Run	000083SMH	X	817	VICAR LA	Yard-Back	09/05/2012	09/05/2012	Truck 1	1		37	38	0		3
Taylor Run	000084IN	X	3300	KING ST	Sidewalk	09/07/2012	09/07/2012	Truck 1	1		0	0	0		2
Taylor Run	000084SMH	X	1305	KEY DR	Light Highway Rural Streets	08/23/2012	08/23/2012	Truck 1	1		57	58	0		4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Pipe Connection-2	I/I evidence				I/I						
Taylor Run	000085SMH	X	1304	KEY DR	Light Highway Rural Streets	08/23/2012	08/23/2012	Truck 1	1		58	59	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Mortar missing	Min: <10% of area			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Channel	Mortar missing	Min: <10% of area			Structural						
				Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Taylor Run	000086SMH	X	1401	KEY DR	Light Highway Rural Streets	08/23/2012	08/23/2012	Truck 1	1		54	55	0		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Mortar missing	Min: <10% of area			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Channel	Mortar missing	Min: <10% of area			Structural						
				Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
TAYLOR RUN	000087ND	X		DARTMOUTH		09/13/2012	09/13/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000097ND	X	151	MONCURE DR		09/14/2012	09/14/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000097SMH	X	1404	KEY DR	Light Highway Rural Streets	08/23/2012	08/23/2012	Truck 1	1		62	63	0		3
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Mortar missing	Min: <10% of area		Structural						
Taylor Run	000098ND	X	152	MONCURE DR		09/14/2012	09/14/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000098SMH	X	1408	KEY DR	Driveway	08/23/2012	08/23/2012	Truck 1	1		69	71	0		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Bench	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Channel	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Channel	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
Taylor Run	000101ND	X	152	HILTON ST		09/14/2012	09/14/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000104ND	X	600	JANNEYS LA		09/25/2012	09/25/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000105ND	X	600	MELROSE ST		09/26/2012	09/26/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000108ND	X	521	JANNEYS LA		09/25/2012	09/25/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000109IN	X	3125	KING ST	Sidewalk	10/09/2012	10/09/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000116ND	X	414	SKYHILL RD		09/17/2012	09/17/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000117ND	X	707	JANNEYS LA		09/17/2012	09/17/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000121ND	X	1302	KEY DR		08/22/2012	08/22/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000126CP	X	2932	KING ST	Easement	09/12/2012	09/12/2012	Truck 1	1		0	0	0		1
TAYLOR RUN	000126CP-A	X		KING	Easement	09/12/2012	09/12/2012	Truck 1	1		0	0	0		1
Taylor Run	000127CP	X	2932	KING ST	Easement	09/12/2012	09/12/2012	Truck 1	1		0	0	0		1
TAYLOR RUN	000127CP-A	X		KING	Easement	09/12/2012	09/12/2012	Truck 1	1		0	0	0		1
Taylor Run	000131IN	X	3500	KING ST	Sidewalk	10/11/2012	10/11/2012	Truck 1	1		37	38	0		1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Taylor Run	000172IO	X	2900	BUSINESS CENTER DR E	Easement	09/18/2012	09/18/2012	Truck 1	1		0	0	0		1
Taylor Run	000186SMH	X	3680	KING ST	Parking Lot	09/06/2012	09/06/2012	Truck 1	1		56	57	0		3
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Taylor Run	000187SMH	X	3680	KING ST	Sidewalk	09/06/2012	09/06/2012	Truck 1	1		50	51	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000202SMH	X	301	CROWN VIEW DR	Light Highway Rural Streets	09/13/2012	09/13/2012	Truck 1	1		59	61	0		4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000204SMH X	2800	DARTMOUTH RD		Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Taylor Run	000204SMH X	2800	DARTMOUTH RD	Sidewalk	09/13/2012	09/13/2012	Truck 1	1	50	51
Taylor Run	000205SMH X	301	CROWN VIEW DR		Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000205SMH X	301	CROWN VIEW DR		Sidewalk	09/13/2012	09/13/2012	Truck 1	1	53	54	0			2
Taylor Run	000206SMH X	2800	DARTMOUTH RD		Frame	Offset	Min: 7/8" to 2" (2.5-5cm)	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Taylor Run	000206SMH X	2800	DARTMOUTH RD	Light Highway Rural Streets	09/13/2012	09/13/2012	Truck 1	1	50	51	0				3
Taylor Run	000207SMH X	301	CROWN VIEW DR		Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000207SMH	X	2800	DARTMOUTH RD	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural			60	61	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Bench	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
Taylor Run	000208SMH	X	236	W TAYLOR RUN PY	Light Highway Rural Streets	09/13/2012	09/13/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000209SMH	X	236	W TAYLOR RUN PY	Light Highway Rural Streets	09/13/2012	09/13/2012	Truck 1	1		54	55	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Taylor Run	000227SMH	X	151	MONCURE DR	Light Highway Rural Streets	09/14/2012	09/14/2012	Truck 1	1		40	40	0		2
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Pipe Connection-1	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
Taylor Run	000231SMH	X	152	HILTON ST	Light Highway Rural Streets	09/14/2012	09/14/2012	Truck 1	1		59	61	0		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Channel	Mortar missing	Min: <10% of area			Structural						
				Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Channel	Bricks displaced or missing	Min: <5% of area			Structural						
Taylor Run	000233SMH	X	735	UPLAND PL	Light Highway Rural Streets	09/14/2012	09/14/2012	Truck 1	1		59	60	0		3
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Chimney/Shft	Mortar missing	Min: <10% of area			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Mortar missing	Min: <10% of area			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000235SMH X	723		UPLAND PL	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	Mortar missing	Min: <10% of area			Structural					
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area			Structural					
					Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural					
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
					Chamber	Mortar missing	Min: <10% of area			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000237SMH X		10	E TAYLOR RUN PY	Easement	10/12/2012	10/12/2012	Truck 1	1		56	57	0		4
				DUKE ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Taylor Run	000238SMH X		2501	DUKE ST	Easement	10/12/2012	10/12/2012	Truck 1	1		47	48	0		4
				MONCURE DR	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000239SMH X		105	MONCURE DR	Easement	10/12/2012	10/12/2012	Truck 1	1		28	29	0		4
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000251SMH	X	2836	DUKE ST	Parking Lot	09/19/2012	09/19/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000252SMH	X		DUKE	Sidewalk	09/19/2012	09/19/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000253SMH	X	2712	DUKE ST	Light Highway Rural Streets	10/12/2012	10/12/2012	Truck 1	1		49	50	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000256SMH	X	109	E TAYLOR RUN PY	Yard-Back	09/14/2012	09/14/2012	Truck 1	1		53	54	0		2
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Taylor Run	000257SMH	X	2600	BUSINESS CENTER DR E	Easement	09/19/2012	09/19/2012	Truck 1	1		0	0	0		3
Taylor Run	000260SMH	X	608	MELROSE ST	Light Highway Rural Streets	09/26/2012	09/26/2012	Truck 1	1		56	57	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Taylor Run	000265SMH	X	1105	E TAYLOR RUN PY	Yard-Front	09/12/2012	09/12/2012	Truck 1	1		60	61	0		2
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Mortar missing	Min: <10% of area	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Pipe Connection-2	Pipe cracked	Maj: 3/16"-1/4" (5-6mm) width	Structural							
Taylor Run	000266SMH	X	927	E TAYLOR RUN PY	Yard-Front	09/11/2012	09/11/2012	Truck 1	1		0	0	0		2
Taylor Run	000268SMH	X	404	JANNEYS LA	Light Highway Rural Streets	09/25/2012	09/25/2012	Truck 1	1		29	29	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000269SMH	X	509	JANNEYS LA	Light Highway Rural Streets	09/25/2012	09/25/2012	Truck 1	1		56	57	0		4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000270SMH	X	519	JANNEYS LA	Light Highway Rural Streets	09/25/2012	09/25/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000271SMH	X	600	MELROSE ST	Light Highway Rural Streets	09/25/2012	09/25/2012	Truck 1	1		61	62	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000282SMH	X	607	JANNEYS LA		09/26/2012	09/26/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	000283SMH	X	696	JANNEYS LA	Light Highway Rural Streets	09/26/2012	09/26/2012	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000284SMH	X	611	JANNEYS LA		09/26/2012	09/26/2012	Truck 1	1	Not Opened	0	0	0		0
Taylor Run	000291SMH	X	714	JANNEYS LA	Light Highway Rural Streets	09/17/2012	09/17/2012	Truck 1	1		70	71	0		3
					Frame Base Seal	Cracked / deteriorated	Maj: 3/8"-3/4" (10-20mm) width, pieces, missing		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000292SMH	X	802	JANNEYS LA	Light Highway Rural Streets	09/26/2012	09/26/2012	Truck 1	1		56	57	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Taylor Run	000294SMH X	801	JANNEYS LA	Light Highway Rural Streets	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)				Structural					
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces				Structural					
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
Taylor Run	000297SMH X	414	SKYHILL RD	Sidewalk	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
Taylor Run	000298SMH X	411	CLOVERWAY	Light Highway Rural Streets	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
Taylor Run	000309SMH X	3737	SEMINARY RD	Sidewalk	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
Taylor Run	000309SMH X	3737	SEMINARY RD	Sidewalk	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Taylor Run	000310SMH	X	3737	SEMINARY RD	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
Taylor Run	000310SMH	X	3737	SEMINARY RD	Light Highway Rural Streets	10/12/2012	10/12/2012	Truck 1	1		50	50	0		5	
Taylor Run	000313SMH	X	1437	JANNEYS LA	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces									
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching									
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
Taylor Run	000332IO	X	2460	EISENHOWER AV		09/24/2012	09/24/2012	Truck 1	1	Not found	0	0	0		0	
Taylor Run	000334IO	X		TELEGRAPH		09/20/2012	09/20/2012	Truck 1	1	Not found	0	0	0		0	
Taylor Run	000335IO	X	2700	EISENHOWER AV	Parking Lot	09/20/2012	09/20/2012	Truck 1	1		0	0	0		1	
Taylor Run	000467IN	X	3680	KING ST	Sidewalk	09/06/2012	09/06/2012	Truck 1	1		50	50	0		5	
Taylor Run	000469IN	X	3680	KING ST	Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching									
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces									
Taylor Run	000469IN	X	3680	KING ST	Easement	09/06/2012	09/06/2012	Truck 1	1		46	46	0		2	
Taylor Run	000474SMH	X	900	JANNEYS LA	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
Taylor Run	000474SMH	X	900	JANNEYS LA	Light Highway Rural Streets	09/26/2012	09/26/2012	Truck 1	1		56	57	0		2	
Taylor Run	000474SMH	X	900	JANNEYS LA	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching									
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000475SMH	X	904	JANNEYS LA	Light Highway Rural Streets	09/26/2012	09/26/2012	Truck 1	1		74	76	0		3
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Bricks displaced or missing	Min: <5% of area		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	000530IO	X	2932	KING ST	Easement	09/12/2012	09/12/2012	Truck 1	1		0	0	0		1
Taylor Run	000568IN	X	317	LAMOND PL	Sidewalk	09/11/2012	09/11/2012	Truck 1	1		44	45	0		3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Taylor Run	000572IN	X	315	LAMOND PL	Sidewalk	09/11/2012	09/11/2012	Truck 1	1		37	38	0		4
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000576IN	X	314	MONCURE DR	Sidewalk	09/11/2012	09/11/2012	Truck 1	1		46	47	0		4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-4	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000577IN	X	305	E TAYLOR RUN PY	Sidewalk	09/11/2012	09/11/2012	Truck 1	1		46	47	0		2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000579IN	X	305	E TAYLOR RUN PY	Sidewalk	09/11/2012	09/11/2012	Truck 1	1		50	51	0		2
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000591IN	X	301	CROWN VIEW DR	Sidewalk	09/13/2012	09/13/2012	Truck 1	1		42	38	5		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenanc						
Taylor Run	000594IN	X	2806	DARTMOUTH RD	Sidewalk	09/13/2012	09/13/2012	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	000595IN	X	2800	DARTMOUTH RD	Sidewalk	09/13/2012	09/13/2012	Truck 1	1		37	38	0		2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
Taylor Run	000603ND	X		WILLIAMSBURG		09/20/2012	09/20/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000606IN	X	302	LAMOND PL	Sidewalk	09/11/2012	09/11/2012	Truck 1	1		43	38	15		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
				Channel	Debris/deposition	Mod: 1-3gal bucket	Maintenanc								
Taylor Run	000616ND	X		WILIAMSBURG		09/20/2012	09/20/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000618ND	X	2600	BUSINESS CENTER DR E		09/24/2012	09/24/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	000622ND	X		CABIN CREEK		09/20/2012	09/20/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000642IN	X	105	MONCURE DR	Sidewalk	10/12/2012	10/12/2012	Truck 1	1		0	0	0		4
Taylor Run	000643IN	X	105	MONCURE DR	Sidewalk	10/12/2012	10/12/2012	Truck 1	1		48	49	0		2
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural								
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
Taylor Run	000687IN	X	103	E TAYLOR RUN PY	Yard-Back	09/14/2012	09/14/2012	Truck 1	1		59	60	0		2
				Chamber	Bricks displaced or missing	Min: <5% of area	Structural								
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
				Chamber	Mortar missing	Min: <10% of area	Structural								
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
Taylor Run	000701IN	X	1105	E TAYLOR RUN PY	Yard-Back	09/12/2012	09/12/2012	Truck 1	1		50	50	0		2
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural								
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching	Structural								
Taylor Run	000713IN	X	600	MELROSE ST		09/26/2012	09/26/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	000758ND	X	2602	KING ST		09/25/2012	09/25/2012	Truck 1	1	No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000764IN	X	1040	W TAYLOR RUN PY	Sidewalk	09/12/2012	09/12/2012	Truck 1	1		50	50	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Structural							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
Taylor Run	000767IN	X	319	LAMOND PL	Yard-Side	09/11/2012	09/11/2012	Truck 1	1		50	51	0		2
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Taylor Run	000813SMH	X	2900	BUSINESS CENTER DR E	Light Highway Rural Streets	09/18/2012	09/18/2012	Truck 1	1		29	29	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Taylor Run	000814SMH	X	3000	BUSINESS CENTER DR		09/18/2012	09/18/2012	Truck 1	1	D.N.E	0	0	0		0
Taylor Run	000815IN	X	1316	BISHOP LA	Yard-Front	09/05/2012	09/05/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Taylor Run	000815SMH	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	09/18/2012	Truck 1	1		45	46	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Taylor Run	000816IN	X	1313	BISHOP LA	Yard-Front	09/05/2012	09/05/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000816SMH X		2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	09/18/2012	Truck 1	1		0	0	0		3
Taylor Run	000816SMH X-A			ROTH	Parking Lot	09/18/2012	09/18/2012	Truck 1	1		0	0	0		2
Taylor Run	000817IN X		1313	BISHOP LA	Yard-Front	09/05/2012	09/05/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000817SMH X		2900	BUSINESS CENTER DR E	Light Highway Rural Streets	09/18/2012	09/18/2012	Truck 1	1		56	57	0		4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000818IN X		904	VICAR LA	Yard-Front	09/05/2012	09/05/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000818SMH X		3000	BUSINESS CENTER DR		09/18/2012	09/18/2012	Truck 1	1	D.N.E	0	0	0		0
Taylor Run	000820SMH X		2600	BUSINESS CENTER DR E	Easement	09/19/2012	09/19/2012	Truck 1	1		0	0	0		2
Taylor Run	000822IN X		817	VICAR LA	Yard-Side	09/05/2012	09/05/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Taylor Run	000824IN X		1401	KEY DR	Sidewalk	08/23/2012	08/23/2012	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000858IN	X	802	HALL PL	Sidewalk	09/05/2012	09/05/2012	Truck 1	1		50	51	0		3
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000859IN	X	1305	KEY DR	Curb/Gutter	08/23/2012	08/23/2012	Truck 1	1		49	50	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Channel	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
Taylor Run	000871IN	X	915	N QUAKER LA	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		44	45	0		3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000872IN	X	3737	SEMINARY RD	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		37	38	0		4
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000873IN	X	3737	SEMINARY RD	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		37	38	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000874IN	X	3737	SEMINARY RD	Light Highway Rural Streets	09/04/2012	09/04/2012	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	000875IN	X	910	VICAR LA	Yard-Back	09/05/2012	09/05/2012	Truck 1	1		37	38	0		1
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	000879IN	X		Quaker Ln.	Sidewalk	09/04/2012	09/04/2012	Truck 1	1		42	42	0		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	001531SMH	X	2460	EISENHOWER AV	Light Highway Rural Streets	09/24/2012	09/24/2012	Truck 1	1		44	44	0		2
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	001532SMH	X	2460	EISENHOWER AV	Easement	09/24/2012	09/24/2012	Truck 1	1		0	0	0		3
Taylor Run	001533SMH	X	2460	EISENHOWER AV	Driveway	09/24/2012	09/24/2012	Truck 1	1		50	51	0		3
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	001546SMH	X	2751	EISENHOWER AV	Light Highway Rural Streets	09/20/2012	09/20/2012	Truck 1	1		50	51	0		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	001548SMH	X	233	TELEGRAPH RD	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		53	54	0		3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	001549SMH	X	233	TELEGRAPH RD	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	001560SMH	X	100	TELEGRAPH RD	Easement	09/24/2012	09/24/2012	Truck 1	1		0	0	0		2
Taylor Run	001562SMH	X	100	TELEGRAPH RD	Driveway	09/24/2012	09/24/2012	Truck 1	1		22	22	0		3
Taylor Run	001563SMH	X	2387	DUKE ST	Driveway	09/24/2012	09/24/2012	Truck 1	1		55	56	0		3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	002036ND	X		WITTER		09/19/2012	09/19/2012	Truck 1	1	Not found	0	0	0		0
Taylor Run	002105ND	X		Roth		09/18/2012	09/18/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	002429IN	X	3000	COLVIN ST E	Sidewalk	09/18/2012	09/18/2012	Truck 1	1		56	56	0		1
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
Taylor Run	002430IN	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	09/18/2012	Truck 1	1		50	50	0		2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
Taylor Run	002431IN	X	2900	BUSINESS CENTER DR E	Parking Lot	09/18/2012	09/18/2012	Truck 1	1		37	38	0		1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	002550SMH	X	1430	W BRADDOCK RD	Light Highway Rural Streets	09/06/2012	09/06/2012	Truck 1	1		29	29	0		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	002579SMH	X	1720	W BRADDOCK RD	Light Highway Rural Streets	10/10/2012	10/10/2012	Truck 1	1		48	49	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	002890SMH	X	2932	KING ST	Parking Lot	09/12/2012	09/12/2012	Truck 1	1		0	0	0		3
Taylor Run	002891SMH	X	2932	KING ST	Parking Lot	09/12/2012	09/12/2012	Truck 1	1		0	0	0		2
Taylor Run	002893SMH	X	2932	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		68	69	0		3
					Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Taylor Run	002894SMH	X	2836	KING ST	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		76	76	0		4
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	Cracked / deteriorated	Maj: 3/8"-3/4" (10-20mm) width, pieces, missing		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chimney/Shft	Mortar missing	Mod: 10-25% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Pipe Connection-2	Pipe cracked	Extreme: >1/4" (6mm) width, pieces, missing		Structural						
Taylor Run	002895SMH	X	800	HERMITAGE CT	Light Highway Rural Streets	10/09/2012	10/09/2012	Truck 1	1		70	71	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chimney/Shft	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Taylor Run	002897SMH	X	2932	KING ST	Pavement Concrete	10/09/2012	10/09/2012	Truck 1	1		70	70	0		3
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area		Structural						
					Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Mortar missing	Mod: 10-25% of area		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	002901SMH	X	805	HERMITAGE CT	Light Highway Rural Streets	09/12/2012	09/12/2012	Truck 1	1		40	40	0		4
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	002902SMH	X	805	HERMITAGE CT	Light Highway Rural Streets	09/12/2012	09/12/2012	Truck 1	1		53	54	0		3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Taylor Run	002905SMH	X	2602	KING ST	Light Highway Rural Streets	09/25/2012	09/25/2012	Truck 1	1		70	71	0		3
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Taylor Run	004064SMH	X		ROTH	Parking Lot	09/18/2012	09/18/2012	Truck 1	1		0	0	0		3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
TAYLOR RUN	004065SMH	X		ROTH		09/18/2012	09/18/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	004066SMH	X		ROTH	Easement	09/20/2012	09/20/2012	Truck 1	1		0	0	0		2
Taylor Run	004067SMH	X		WITTER	Parking Lot	09/19/2012	09/19/2012	Truck 1	1		0	0	0		3
Taylor Run	004068SMH	X		QUAKER	Light Highway Rural Streets	10/12/2012	10/12/2012	Truck 1	1		0	0	0		2
Taylor Run	004865IN	X	2751	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1	No Access	0	0	0		0
Taylor Run	004868IN	X	233	TELEGRAPH RD	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		28	29	0		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004869IN	X	2751	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		37	38	0		2
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004870IN	X	2751	EISENHOWER AV	Easement	09/20/2012	09/20/2012	Truck 1	1		0	0	0		2
Taylor Run	004871IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		37	38	0		2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004877IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		44	45	0		3
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural					
Taylor Run	004878IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		37	38	0		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004879IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		37	38	0		2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004880IN	X	2700	EISENHOWER AV	Sidewalk	09/20/2012	09/20/2012	Truck 1	1		37	38	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Taylor Run	004904IN	X	100	TELEGRAPH RD	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004904IN	X	100	TELEGRAPH RD		09/24/2012	09/24/2012	Truck 1	1	Not found	0	0	0		0	
Taylor Run	004908IN	X	100	TELEGRAPH RD	Parking Lot	09/24/2012	09/24/2012	Truck 1	1		37	38	0		2	
Taylor Run	004909IN	X	100	DOVE ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	004909IN	X	100	DOVE ST	Sidewalk	09/24/2012	09/24/2012	Truck 1	1		10	10	0		4	
Taylor Run	004910IN	X	100	DOVE ST	Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Taylor Run	004911IN	X	2412	DUKE ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
Taylor Run	004911IN	X	2412	DUKE ST	Sidewalk	09/24/2012	09/24/2012	Truck 1	1		37	38	0		2	
Taylor Run	005532IN	X	1430	W BRADDOCK RD	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	005532IN	X	1430	W BRADDOCK RD	Parking Lot	09/06/2012	09/06/2012	Truck 1	1		37	38	0		3	
Taylor Run	005535IN	X	2200	MINOR ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	005535IN	X	2200	MINOR ST	Sidewalk	09/06/2012	09/06/2012	Truck 1	1		37	38	0		4	
Taylor Run	005770IN	X	806	HERMITAGE CT	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
Taylor Run	005770IN	X	806	HERMITAGE CT	Sidewalk	09/12/2012	09/12/2012	Truck 1	1		37	38	0		2	
Taylor Run	005770IN	X	806	HERMITAGE CT	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Taylor Run	005778IN	X	2602	KING ST	Sidewalk	09/25/2012	09/25/2012	Truck 1	1		37	38	0		1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Taylor Run	009109IN	X		ROTH	Parking Lot	09/19/2012	09/19/2012	Truck 1	1		44	45	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						

Appendix C – Summary of Structures Not Inspected

Facility ID	Why Not Inspected
000814SMH	Not Inspected - D.N.E
000818SMH	Not Inspected - D.N.E
000003ND	Not Inspected - No Access
000004ND	Not Inspected - No Access
000005ND	Not Inspected - No Access
000006ND	Not Inspected - No Access
000008ND	Not Inspected - No Access
000009ND	Not Inspected - No Access
000010ND	Not Inspected - No Access
000016ND	Not Inspected - No Access
000019ND	Not Inspected - No Access
000022ND	Not Inspected - No Access
000023ND	Not Inspected - No Access
000024ND	Not Inspected - No Access
000027IN	Not Inspected - No Access
000030ND	Not Inspected - No Access
000034ND	Not Inspected - No Access
000035ND	Not Inspected - No Access
000037ND	Not Inspected - No Access
000039ND	Not Inspected - No Access
000060ND	Not Inspected - No Access
000081ND	Not Inspected - No Access
000087ND	Not Inspected - No Access
000097ND	Not Inspected - No Access
000098ND	Not Inspected - No Access
000101ND	Not Inspected - No Access
000104ND	Not Inspected - No Access
000105ND	Not Inspected - No Access
000108ND	Not Inspected - No Access
000116ND	Not Inspected - No Access
000117ND	Not Inspected - No Access
000121ND	Not Inspected - No Access
000284SMH	Not Inspected - No Access
000603ND	Not Inspected - No Access
000616ND	Not Inspected - No Access
000622ND	Not Inspected - No Access
000713IN	Not Inspected - No Access
000758ND	Not Inspected - No Access
002105ND	Not Inspected - No Access
004065SMH	Not Inspected - No Access
004865IN	Not Inspected - No Access

Facility ID	Why Not Inspected
000006IO	Not Inspected - Not found
000013SMH	Not Inspected - Not found
000029ND	Not Inspected - Not found
000047IO	Not Inspected - Not found
000082IN	Not Inspected - Not found
000282SMH	Not Inspected - Not found
000332IO	Not Inspected - Not found
000334IO	Not Inspected - Not found
000618ND	Not Inspected - Not found
002036ND	Not Inspected - Not found
004904IN	Not Inspected - Not found

Appendix D - Summary of Observed Pipe Defects

SCREAMTM Lamping - Summary of Observed Defects

Alexandria - Taylor Run

Pipe	SCREAM Total Score	USMH Bldg	MH Street	Observed	Inventory	Structural			
				Infiltration	Information	Collapse	Crack		
				Infiltration (Count)	General Remark (Count)	Collapsed (Count)	Crack 3-Hinge (Length)	Cracks Multiple (Count)	Cracks Multiple (Length)
<u>000824IN-000084SMH</u>	7	1401	KEY DR	1	0	0	0	0	0
<u>000572IN-000576IN</u>	7	315	LAMOND PL	1	0	0	0	0	0
<u>000291SMH-000056IO</u>	7	705	JANNEYS LA	1	0	0	0	0	0
<u>004909IN-001562SMH</u>	7	26	DOVE ST	1	0	0	0	0	0
<u>004910IN-004909IN</u>	7	26	DOVE ST	1	0	0	0	0	0
<u>000579IN-000606IN</u>	7	305	TAYLOR RUN PY	1	0	0	0	0	0
<u>000642IN-000643IN</u>	7	105	MONCURE DR	1	0	0	0	0	0
<u>000643IN-000239SMH</u>	7	105	MONCURE DR	1	0	0	0	0	0
<u>000116ND-000291SMH</u>	7	707	JANNEYS LA	1	0	0	0	0	0
<u>004906IN-001562SMH</u>	7	26	DOVE ST	1	0	0	0	0	0
<u>004912IN-001563SMH</u>	7	2350	DUKE ST	1	0	0	0	0	0
<u>000576IN-000577IN</u>	8	314	MONCURE DR	2	0	0	0	0	0
<u>000577IN-000579IN</u>	8	305	TAYLOR RUN PY	2	0	0	0	0	0
<u>000032SMH-000003CB</u>	9	3401	KING ST	0	0	0	0	0	4
<u>000265SMH-000050IO</u>	9	1105	TAYLOR RUN PY	0	0	0	0	0	4
<u>000097ND-000227SMH</u>	9	151	MONCURE DR	0	0	0	0	0	4
<u>004065SMH-000044IO</u>	23	302	LAMOND PL	0	0	0	0	1	0
<u>000031SMH-000032SMH</u>	34	3401	KING ST	0	0	0	4	0	0
<u>000531IO-002894SMH</u>	100	801	HERMITAGE CT	0	0	1	0	0	0
Total				15	7	1	4	1	12